

Reference	SSM76256
Models	Discovery / L462
Title	Accessory `Fixed Side Step` - Brackets Cracked
Category	Body
Last modified	28-Jan-2025 00:00:00
Symptom	108000 Ext. Trim/Accessories

Content **Model / Model Year / Derivative**

Discovery / 21MY onwards / All

Situation:

JLR Engineering investigations have identified reports of front brackets for accessory 'Fixed Side Steps' being installed without the spacers. This causes the brackets to fracture during installation.

The spacers are required when installing the 'Fixed Side Steps' on 21MY onwards vehicles and are detailed in the TOPIx installation instructions.

Action:

Refer to the service information below.

Service Information:

When installing accessory 'Fixed Side Steps' VPLRP0347 and VPLRP0530 on 21MY onwards vehicles, follow the TOPIx installation instructions - Refer to workshop manual section:

102-03 - Exterior - Fixed Side Steps - VPLRP0269/VPLRP0347 (G2738368) - REMOVAL AND INSTALLATION.

Spacer kit 'VPLRP0487' must be installed on the front brackets as shown in step 5 of the installation instructions.

(Ref 000395334 / 3713)

anBhdHRlcnM7MjAyNS0wMS0yOVQxNToyNjpyMy4wMzNaOzE2NS4yMjUuOS45ODs=