



SSM 53365 2024 Bronco - Will Not Shift Out Of Park With DTC B1319 Stored In The BCM - Built On And After 23-Jul-2024

Some 2024 Bronco vehicles built on and after 23-Jul-2024 may exhibit a concern where the vehicle intermittently will not shift out of park in cold weather conditions with diagnostic trouble code (DTC) B1319 stored in the body control module (BCM). This may be due to the BCM. To correct this concern, replace the BCM with service part number RU5Z-15604-BJ. The parts catalog may be incorrect and is in the process of being updated to show the correct BCM for vehicles built within this window. Be advised that due to sudden high demand, these BCMs may be in short supply and Ford is currently working to address this. Attempting to install a different version BCM in these vehicles may result in various operational issues.