

GPOP - Issue Review System

Part Number: 68617742A\$

Part Description: Frnt Stabilizer assembly

Issue Description: BSR from the front end due to Smartbar (disconnecting front sway bar). Root cause was identified as anti-rotation bracket (connects the actuator to the stabar) coming loose due to inadequate clamp load at the joint and weld (holds the bolt shaft and bracket flange) was poorly designed. If any vehicle causes BSR because of this Bracket failure (loose joint/ bracket bends) DO NOT replace whole stabar assembly, instead replace with the service kit (PN#68730602AA). Dealer must need to order the parts from part ordering system for this claim. This kit contains 1 bracket (PN 68730603AA), 3 M10 Nut (PN 68730605AA), 2 M8X1.5 Bolt (PN 68730606AA) and 2 M10X1.5 bolt (PN 06513427AA). 1 M10 Bolt (PN 68730607AA). This kit will also contain a new torque instruction for the bolt which holds the clamp bracket to this failed anti-rotation bracket. DO NOT apply the old torque (45+/5Nm Direct torque). The new torque is Angle controlled torque monitor (20Nm Snug torque, 110 deg Angle, monitor torque within 40-70Nm). Please use Service Library for your reference.