



STAR ONLINE PUBLICATION



Case Number: S2508000009


Release Date: February 2025

Symptom/Vehicle Issue: Flashing Odometer, No Diagnostic Trouble Codes (DTCs)

Customer Complaint/Technician Observation: The owner or dealer technician may observe the odometer flashing concern. The technician has not observed any obvious DTCs that are setting.

Discussion: Vehicles may exhibit Odometer Flash concern indicating a proxi misalignment or issue with Proxi with other Electronic Control Units (ECUs) misalignments. In some cases, some vehicles may have Fuse CB2 installed in error.

Inspect the rear Power Distribution Center (PDC) for the SPAAK module fuse as highlighted. Remove the fuse CB2 perform a key cycle to confirm if the odometer behavior has been resolved. If no change, use the scan tool to perform the Proxi alignment found in the guided diagnostics folder after the fuse has been removed to complete.

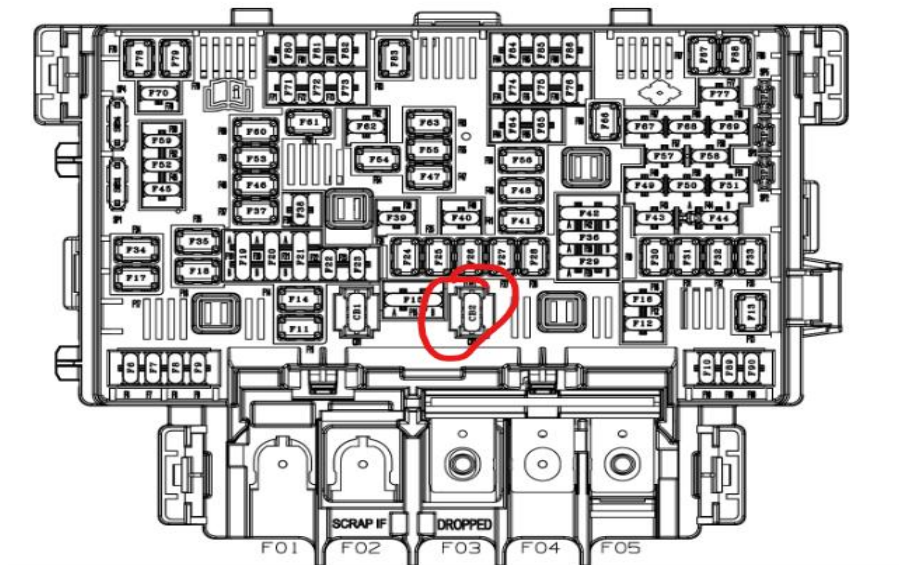

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.