



STAR ONLINE PUBLICATION



Case Number: S2508000016

Release Date: February 2025

Symptom/Vehicle Issue: Alarm Siren Does Not Function

Customer Complaint/Technician Observation: The owner complains the vehicles siren is not working. The technician observes the vehicles Body Control Module (BCM) sets Diagnostic Trouble Code (DTC) U1412-09 Alarm Siren Unit (ASU) Component Failure.

Repair Procedure: An improperly seated connector may create a concern with the siren operation and set the above DTC. Inspect the involved connector at the siren, disconnect and reconnect and secure the connector at the siren. Ensure fuse F090 at the Body Control Module (BCM) is securely in place and retest the operation. If the DTC remains active continue with the service diagnostics within Service Library (SL) to complete Fig 1 and 2.

VEHICLE THEFT SECURITY SYSTEM

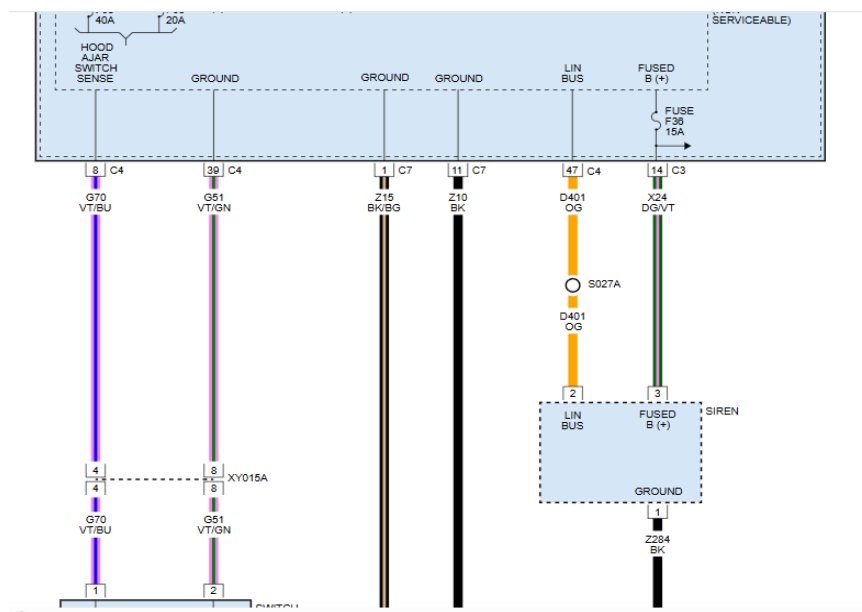


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.



STAR ONLINE PUBLICATION



Example : Hornet black 3-way connector D5907A.

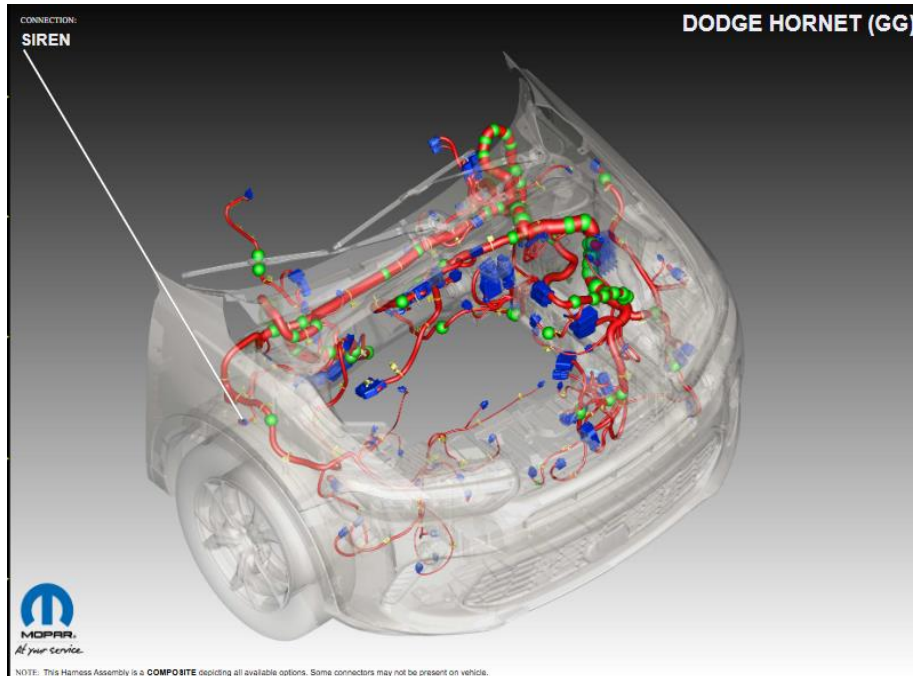


Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.