

REFERENCE:	TSB: 23-005-25 REV. A GROUP: 23 - Body	Date:	February 13, 2025	REVISION:	23-005-25
VEHICLES AFFECTED:	2023 - Current (GC) Alfa Romeo Tonale 2023 - Current (GG) Dodge Hornet	MARKET APPLICABILITY:			
		<input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH			
CUSTOMER SYMPTOM:	<p>**Customers may experience one or more of the following:**</p> <ul style="list-style-type: none"> **If the driver door is ajar, an audible warning and two visual indications are provided on the Instrument Panel Cluster (IPC) to notify the driver the door is not closed. Additionally the parking brake will apply when attempting to drive away if the driver door is not latched close. If the passenger door is ajar, an audible warning and two visual indications are provided to notify to the driver the door is not latched. The issue occurs only in severe low temperature conditions and when vehicle's interior temperature increases the behavior is restored.** One or both front doors will not open or close properly using the exterior door handle <p>NOTE: This symptoms can be more noticeable due to icy conditions.</p>				
CAUSE:	Manufacturing issue				

This bulletin supersedes Technical Service Bulletin (TSB) 23-005-25, date of issue February 11, 2025, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include an additional Customer Symptoms, updated Customer Symptoms statement and Spare Parts table part number.

DISCUSSION:

This Information Only TSB is to communicate the updated parts numbers for the exterior door handle support mechanism Fig. 1 and cable.

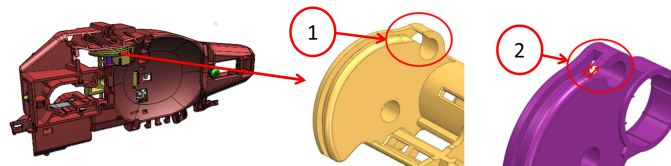


Fig. 1
Exterior Door Handle Support Mechanism

1 - Old Design
2 - Updated Design

UPDATED PART NUMBERS:

Part No.	Description	Notes
50573687 68629753AA - Mopar	Bracket, Door Handle	Right
50573689 68629752AA - Mopar	Bracket, Door Handle	Left
68613383AA	Cable, Outside Handle - Front Door	Tie Rod

POLICY:

Information Only

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.