

Technical Service Bulletin (TSB)

Fuel Tank Protection Covers Missing

REFERENCE:	TSB: 14-006-25 GROUP: 14 - Fuel	Date:	February 21, 2025	REVISION:	-
VEHICLES AFFECTED:	2025 (B1) Jeep Renegade This bulletin applies to the vehicle built on or after July 09, 2024 (MDH 0709XX) and on or before January 25, 2025 (MDH 0125XX) equipped with 1.3L I4 Turbo Mair DI Eng w/ESS E100 (Sales Code EYJ).			MARKET APPLICABILITY: ☐ NA☐ MEA ☒ SA☐ IAP ☐ EE☐ CH	
CUSTOMER SYMPTOM:	Customers may comment on the following: Fuel tank protection covers are missing.				
CAUSE:	Manufacturing issue				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-019, date of issue February 21, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/ Service Library. All repairs are reimbursable within the provisions of warranty.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-60-03-91	Fuel Tank Protection Covers - Install (0 - Introduction)	1 - Engine Repair and Performance	0.5 Hrs.
Failure Code	ZZ	Service Action	

REPAIR SUMMARY:

This bulletin involves installing the left and right fuel tank protection covers.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
Manual Riveter	—	—

SPARE PARTS:

Qty	Part No.	Description	Notes
1	7097918 - EMEA 68736600AA - NA	Protective Bracket	
3	7097919 - EMEA 68736604AA - NA	Rivet, Bracket	
5	7097920 - EMEA 68736602AA - NA	Rivet, Hexagonal	
1	7097922 - EMEA 68736597AA - NA	Left Fuel Tank Protector Cover	
1	7097923 - EMEA 68736601AA - NA	Right Fuel Tank Protector Cover	
6	7097921 - EMEA 68736603AA - NA	Screw, Fixing	

NOTE: Parts have been shipped in advance to dealerships based on the failure rate. If used, please place a new order in CSPS, including the chassis where the part was used, to maintain the minimum stock. This notice applies exclusively to this campaign.

NOTE: New part requests will only be released with the inclusion of the order in the 'Recall Order with VIN' screen in CSPS, as per the guidelines of the Standard Procedure '00 - Part Request for Campaign', published in the Service Library

REPAIR PROCEDURE:

1. Raise and support the vehicle. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info>04 - Vehicle Quick Reference / Hoisting / Standard Procedure.
2. Disconnect the clip that secures the harness on the right side of the body [Fig. 1](#).



Fig. 1
Wire Harness Clip

3. Position support bracket on the left-hand floor and secure using two rivets with a manual riveter [Fig. 2](#).

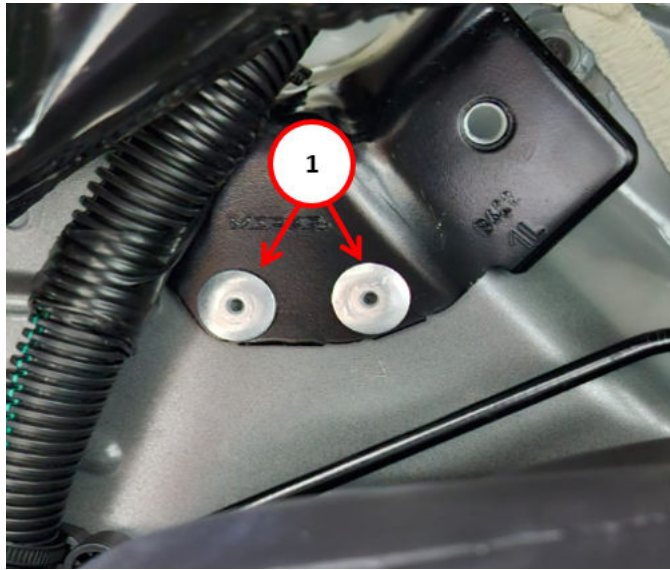


Fig. 2
Support Bracket

1 - Support Bracket Fasteners

4. Apply the third fixing rivet to the support bracket and then insert the harness clip into the previously fixed bracket [Fig. 3](#).

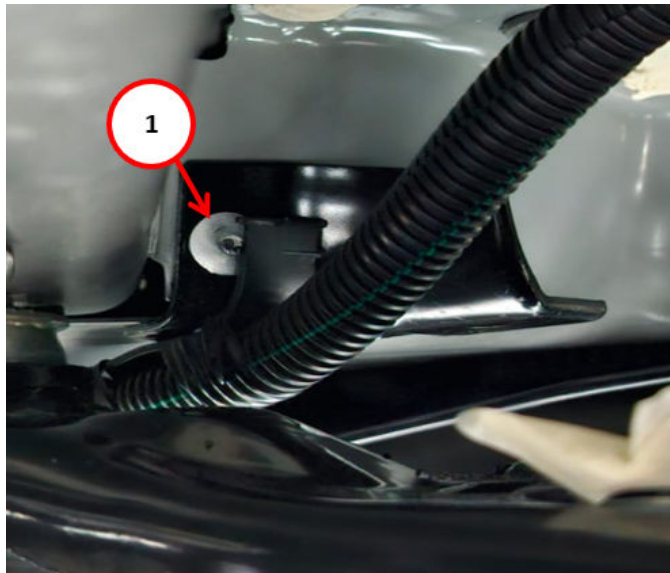


Fig. 3
Support Bracket Rivet

1 - Third Fixing Rivet

5. Insert five fixing plugs (three on the right side and two on the left side of the floor) using a manual riveter with an M8 threaded tip [Fig. 4](#).

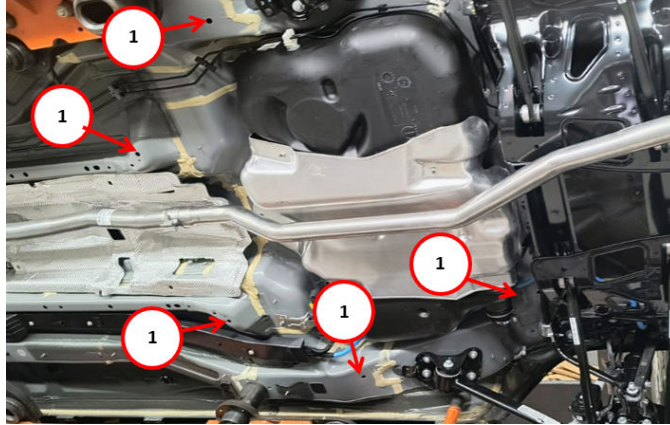


Fig. 4
Fixing Plug Locations

1 - Five Fixing Plug Locations

6. Position the fuel tank protection cover on the left side and hand tighten the three screws (two on the floor and one on the support bracket) [Fig. 5](#).

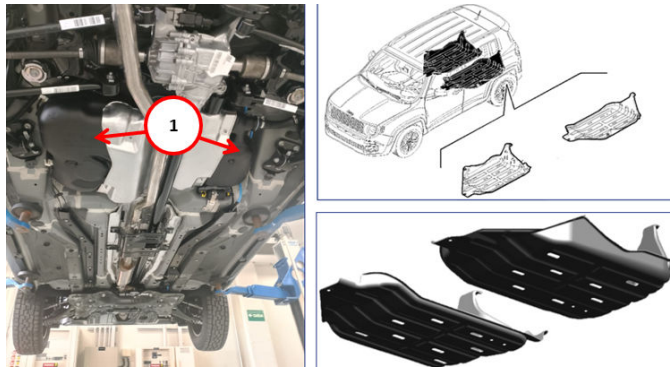


Fig. 5
Fuel Tank Protection Covers

1 - Fuel Tank Protection Covers

7. Position the fuel tank protection cover on the left side and hand tighten the three screws on the floor [Fig. 5](#).
8. Tighten all six fuel tank protection cover screws to 24 N·m (18 ft. lbs.).

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.