



Service Bulletin


Bulletin No.: 25-NA-030

Date: February, 2025

TECHNICAL

Subject: Squeak Type Noise Heard When Applying the Brake Pedal

Brand:	Model:	Model Year:		Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2025	2025	—	—	—	—
GMC	Terrain						

Involved Region or Country	North America, Middle East, Argentina (Mercosur), Brazil (Mercosur)
Condition	Some customers may comment on having a squeak type noise heard when applying the brake pedal.
Cause	The condition may be due to contact between the brake pedal position (BPP) sensor and the pin that moves it.
Correction	<div style="text-align: center;">  </div> <p>Reach up to the top of the brake pedal area and apply Multi-Purpose Lubricant, Superlube (GM Part No. 12346241, in Canada 10953474) or equivalent to the contact point, As shown in the picture above, and cycle the brake pedal a few times to distribute the lubricant.</p> <p style="text-align: right;">6836897</p>

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2486398*	Applying Lubricant to Brake Pedal Position (BPP) Sensor Pin	0.3 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released February 13, 2025

