



**Bulletin No.:** PIC6597

**Published date:** 02/24/2025

## Preliminary Information

**PIC6597 Diagnostic Tip - Service Power Steering, Service Stabilitrak, Service Rear Drive, Service Restraint System U0075 and one or more of the following DTCs set U0131, U0151, U0420, U0452 B197D**

### Models

**Brand: Model: Model Years: VIN: Engine: Transmissions:**  
**from to**

Cadillac CT5 2020 - 2024 All All All All

 
Cadillac CT5-V 2020 - 2024 All All All All

<b>Involved Region or Country</b>	<b>North America</b>
<b>Condition</b>	<b>A customer may comment of the following messages displaying: Service Power Steering, Service Stabilitrak, Service Rear Drive, Service Restraint System. Upon investigation U0075 and one or more of the following DTC's will be set, U0131, U0151, U0420, U0452, B197D.</b>
<b>Cause</b>	<b>Possible Can 1 circuits 4986 or 4987 shorting on passenger seat frame.</b>

### Correction:

**Inspect the passenger seat harness for chaffing on the seat frame, repair any damaged circuits and reroute harness to avoid contact.**

**Harness contacting seat frame.**



**CAN 1 circuit 4987 BU cut.**



**Harness routing to prevent contact.**



### **Warranty Information**

**For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.**

<b>Labor Operation</b>	<b>Description</b>	<b>Labor Time</b>
<b>5430902</b>	<b>Wire-to-Wire Repair</b>	<b>Use Published Labor Time</b>

### **Additional SI Keywords**

can, can1, CT5, CT5-V, D2, drive, power, rear, restraint, restraints, service, stabilitrak, steer, steering, system, U0075, U0131, U0151, U0420, U0452

### **Version History**

<b>Version</b>	<b>1</b>
<b>Modified</b>	<b>02/24/2025 - Created on.</b>