



# Service Bulletin

Bulletin No.: PIP5966A

Date: February, 2025

## PRELIMINARY INFORMATION

**Subject: Diagnostic Aids for DTCS Following Transmission Replacement**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	ATS	2016-2019		All	All	All	M5N,MNU
Cadillac	CTS	2016-2019		All	All	All	M5N,M5U
Cadillac	CT6	2016-2018		All	All	All	M5N,M5X
Cadillac	CT4	2020-2024		All	All	All	M5N,MHA
Cadillac	Escalade	2015-2020		All	All	All	M5U
Chevrolet	Camaro	2016-2023		All	All	All	M5T,M5U
Chevrolet	Corvette	2015-2019		All	All	All	M5U
Chevrolet	Colorado (VIN S/T)	2017-2023		All	All	All	M5T
Chevrolet	Express	2017-2024		All	All	All	M5U
Chevrolet	Silverado	2015-2018		All	All	All	M5U,M5X
Chevrolet	Silverado 1500 (New Model)	2019		All	All	All	MQE
Chevrolet	Silverado 1500	2020-2021		All	All	All	MQE
Chevrolet	Silverado 1500- LTD (RPO J21, VIN Digit 5 = A/D)	2022		All	All	All	M5X
Chevrolet	Silverado 1500- LTD (RPO J22, VIN Digit 5 = W/Y)	2022		All	All	All	M5X,MQE
Chevrolet	Silverado 1500	2022-2023		All	All	All	MQE
GMC	Canyon	2017-2023		All	All	All	M5T
GMC	Sierra	2015-2018		All	All	All	MQE
GMC	Sierra 1500 (New Model)	2019		All	All	All	MQE
GMC	Sierra 1500	2020-2021		All	All	All	MQE
GMC	Sierra 1500 - Limited (RPO J21, VIN Digit 5 = 8/9)	2022		All	All	All	M5X,MQE
GMC	Sierra 1500 - New (RPO J22, VIN Digit 5 = H/U)	2022		All	All	All	M5X,MQE

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
GMC	Sierra 1500	2023		All	All	All	MQE
GMC	Savanna	2017-2023		All	All	All	M5U,MQD
GMC	Yukon	2015-2020		All	All	All	M5U

<b>Involved Region or Country</b>	North America
<b>Condition</b>	The Check Engine light may be on and/or the engine may not start immediately following transmission replacement.
<b>Cause</b>	Incorrect Range Sensor installed .

### Correction

Some Technicians may find immediately following the installation of a SRTA transmission, the vehicle will not start, the check engine light may be on and any or all of the following DTC'S may be set P182A, P182B, P182D, P182E, P1839, P1840.

Upon removal of the transmission pan the Technician may notice a 10 terminal IMS sensor installed rather than a 4 terminal range position sensor.

If this is found; replace the internal harness and the range sensor to a 4 terminal sensor and re-evaluate.

<b>Version</b>	2
<b>Modified</b>	02/06/2025 – Created on. 02/25/2025 – Updated Concern.

