



SIB 52 03 25

2025-02-28

DRIVER SEAT HEATER INOP REPLACEMENT HARNESS 7414701

☒ THIS REPAIR IS MOBILE FRIENDLY
MODEL

| | | | |
|----------------------|----------------------|----------------------------|---------------------------|
| G20 (3 Series Sedan) | G22 (4 Series Coupe) | G23 (4 Series Convertible) | G26 (4 Series Gran Coupe) |
| G42 (2 Series Coupe) | | | |

SITUATION

The driver's seat heater doesn't work after the installation of a replacement seat harness part number (P/N) 52 10 7 414 701.

CAUSE

Seat harness P/N 52 10 7 414 701 applies to the both the front driver's and the front passenger's seat.

This harness is designed to pass the seat heater wiring through the CIS seat occupancy seat mat, even though the CIS seat occupancy seat mat is only installed on the passenger side front seat.

When this seat harness part number is used on the driver's side, the 10-pin electrical connector's A125*1B doesn't plug into anything.

CORRECTION

For the driver's seat, jump the wires to simulate the CIS seat mat wiring as described in this Service Information Bulletin.

PROCEDURE

1. When installing replacement seat harness 52 10 7 414 701 in the driver's seat, the harness must be modified for the seat heater to function.
2. Two jumper wires must be installed, or the wires can be removed from the connector, spliced, soldered together and protected with heat shrink tubing.

See attached wiring diagram [B52 03 25 Attachment](#)

- a. Install a jumper between pins 9 and 10 connector A125*1B.
- b. Install a jumper between pins 7 and 8 connector A125*1B.

PARTS INFORMATION

To determine the part number(s) that applies to the specific vehicle being repaired, enter the VIN / Chassis number into either ETK or AIR, this will consider the specific equipment and/or options that are fitted to the vehicle.

CLAIM INFORMATION

This Service Information Bulletin provides technical and repair-related information.

Eligible and Covered Work/Repairs

This additional work/retrofit solution procedure when done in conjunction with a repair that addresses a verified defect in materials and/or workmanship is covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

To submit a claim, please follow the established and applicable warranty policy and procedures (Labor/Part/Sublet – Bulk supply materials) that apply to the repair being performed.

Additional Work in conjunction with another Repair

| Labor Operation | Description | Labor Allowance |
|-----------------|---|-----------------|
| 52 99 000 | Work time to fabricate/install two jumper wires or remove the applicable wires from the connector and splice them together as described in this Service Information Bulletin. | 3 FRU |

FEEDBACK REGARDING THIS BULLETIN

| | |
|--------------------|---|
| Technical Feedback | To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin |
| Warranty Feedback | To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal |
| Parts Feedback | To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department |

Supporting Materials
[picture_as_pdf B520325 Attachment.pdf](#)

