

REFERENCE:	TSB: 14-004-25 REV. A GROUP: 14 - Fuel System	Date:	February 26, 2025	REVISION:	14-004-25
VEHICLES AFFECTED:	<p>2021 - **2025** (WD) Dodge Durango **2021 - 2022** (WK) Jeep Grand Cherokee**</p> <p>This bulletin applies to WD vehicles built on or after February 01, 2021 (MDH 0201XX) and on or before November 24, 2024 (MDH 1124XX) equipped with a 3.6L V6 VVT Engine Upgrade 1 (Sales Code ERC) or a 5.7L V8 Hemi MDS VVT Engine (Sales Code EZH) or Durango Pursuit Vehicle (Sales Code AZ1).</p>	MARKET APPLICABILITY:			
		<input checked="" type="checkbox"/> NA		<input type="checkbox"/> MEA	
		<input type="checkbox"/> SA		<input type="checkbox"/> IAP	
		<input type="checkbox"/> EE		<input type="checkbox"/> CH	
CUSTOMER SYMPTOM:	<p>Customers may experience the following:</p> <ul style="list-style-type: none"> Extended engine crank condition. 				
CAUSE:	Fuel pressure regulator				

This bulletin supersedes Technical Service Bulletin (TSB) 14-004-25, date of issue February 12, 2025, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include adding a model year, a new vehicle and converting the TSB to an RSU.

****This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-024, date of issue February 26, 2025.****

REPAIR SUMMARY:

This bulletin involves performing a fuel pressure test and possibly replacing the fuel pump module.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-50-01-90	Fuel Pump Module Test and Replace (Left Side) (0 - Introduction)	14 - Fuel System	2.0 Hrs.
Failure Code	ZZ	Service Action	

RELATED LOP:

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-50-01-60	Skid Plate Equipped (0 - Introduction)	14 - Fuel System	0.1 Hrs.

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68535771AB	Module, Fuel Pump/Level Unit	

DIAGNOSIS:

If the customer describes any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Perform a fuel pressure and Fuel system leak down test. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info>29 - Non-DTC Diagnostics / Drivability - Gas / Diagnosis and Testing.
2. Is the fuel pressure and system leak down within specification?
 - YES >>> This bulletin has been completed. Perform further diagnostics.
 - NO >>> Proceed to [Step 3](#).
3. Replace fuel pump module. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info>14 - Fuel System / Fuel Delivery, Gas / Module, Fuel Pump / Removal/ Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.