



WARRANTY BULLETIN

Can-Am On-Road

FEBRUARY 5, 2025

BULLETIN 2025-1 | REVISION A

CAMPAIGN N°2025-0001

! CAUTION

All involved customers must be notified, all involved units must be corrected as per instruction herein.

Origin Motorcycle Software Updates

MODEL YEAR	MODEL	ENGINE
MY25	Origin	Rotax E-Power

IMPORTANT

When receiving a vehicle for service:

- Always lookup the vehicle identification number (VIN) on the Knowledge Center to ensure all required recalls are performed.
- Always connect the vehicle to the BRP diagnostic software (BUDS) to ensure all required updates are performed.

PROBLEM

The current softwares do not allow the following features:

- Vehicle information to be displayed in the BRP GO! app.
- Heated grips activation.

The software updates will also implement various improvements for the EV modules.

SOLUTION

Perform the following software updates using BUDS3:

- VCU
- BMS
- Cluster (Multifunction Gauge)
- OBC (Only early production vehicles are affected. If this update is not listed, it means the correct software was installed at the factory).
- INVT (Inverter)

CORRECTIVE ACTION

1. Always make sure to have at least the BUDS3 version 1.02.012 installed.
2. Using the Multifunction Gauge Update Cable, the BUDS3 Hardware V800 VCI and the BUDS3 V800 VCI, connect the vehicle to BUDS3.

MANDATORY TOOL	
Multifunction Gauge Update Cable (P/N 529036598)	
BUDS3 V800 VCI (P/N 529036613)	
BUDS3 Hardware V800 VCI (P/N 529036614)	

3. Select the "*Vehicle Update*" tab and perform all the required updates.



BUDS

2WV Origin STD MY 25

VCU Cluster BMS ABS GPS INVT MSL OBC

VEHICLE UPDATE

Filters: All Mandatory Optional

Some modules require to be flashed, but no health issue detected

MODULES	STATUS	CODE	
VCU	Mandatory	VCU SW 1F1101337SE8VSM3	Download
Cluster	Mandatory	2WV MY25 10.25" color touchscreen update, SW 710011408	Download
BMS	Mandatory	BMS SW File 24242411241108ZB05ER0, AV102	Download
INVT	Mandatory	Inverter I051113_006_F002AAV01	Download
OBC	Mandatory	Z625AZ714A	Download

14 days 14.4V 389V 89%

BUDS

2WV Origin STD MY 25

VCU Cluster BMS ABS GPS INVT MSL OBC

VEHICLE UPDATE

Filters: All Mandatory Optional

Some modules require to be flashed, but no health issue detected


FLASH INSTALLATION

A new flash will be installed


Validate check marks before clicking INSTALL

- ☒ 1) Fault memory in all modules will be deleted after the update is completed.
- ☒ 2) Make sure that power and connection are stable.
- ☒ 3) The update may require several minutes.

INSTALL CANCEL

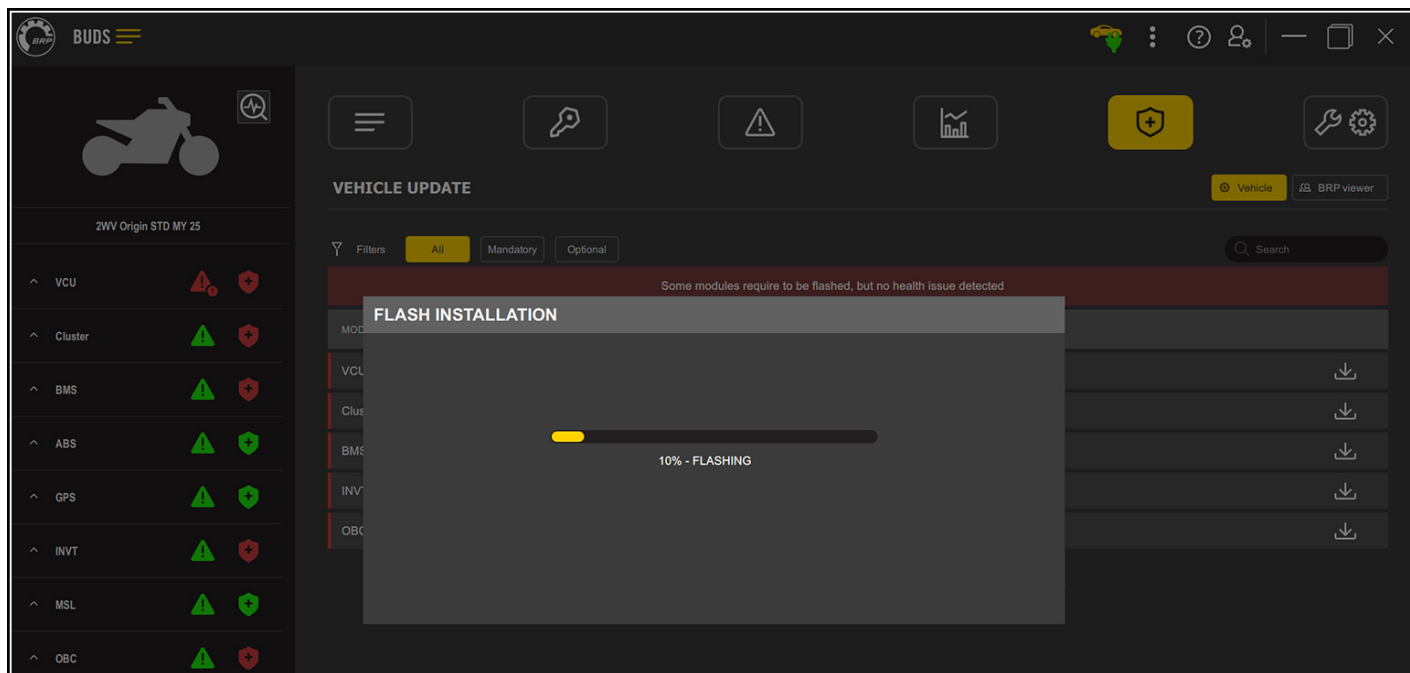

4. Ensure the operation is successful for all the modules.

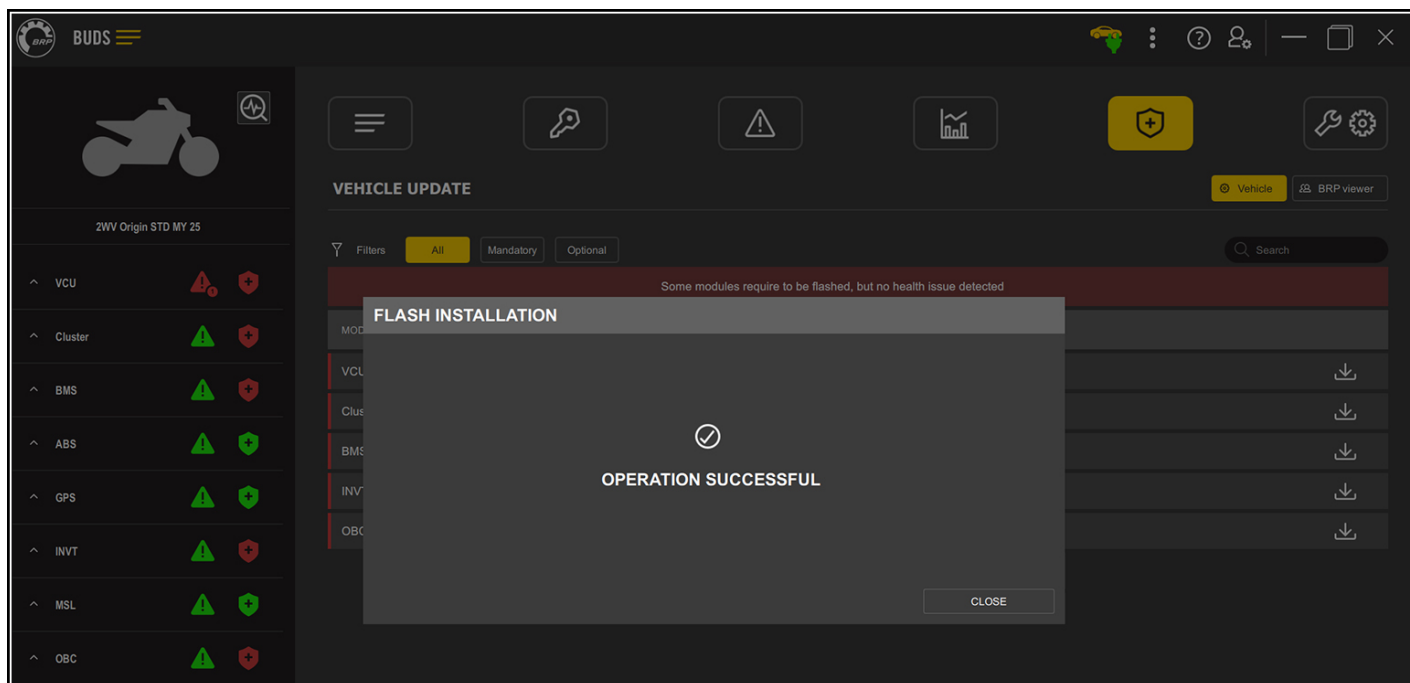

5. After closing the page, an automatic scan will be performed and the updated modules will be removed from the list.

NOTE

The multifunction gauge update is different from the other modules. It is performed with the blue USB cable. When the update is launched, your web browser will automatically open and request to download a file which will be installed by BUDS3. Ensure the download window is open to monitor the progression.



WITH BOSSWEB

CLAIM DETAILS	
Product Line	Motorcycle
Unit Model Year	2025
Campaign/Bulletin/Description	2025-0001 / 2025-1 / SOFTWARE UPDATE
*Action Inspect Repair ☐ ☒	
Total Labor Time Paid	0.3 hour
Expiration Date	January 31, 2027

CLAIM DETAILS	
Claim Type	Unit Campaign
Serial Number	Enter Serial Number
Warranty Campaign	Select <i>SOFTWARE UPDATE / BULLETIN 2025-1 - REPAIR-2WV-2025-0001</i> from the drop-down list
Date of Repair	Repair date
Total Labor Time Paid	0.3 hour
Expiration Date	January 31, 2027