

DTNA Solutions > Service Solutions > Freightliner
> SS 3165-FTL New Cascadia With DT12 Transmission Sl...

SS 3165-FTL New Cascadia With DT12 Transmission Sluggish Throttle Response or Delayed Shift

Applicable Vehicles

New Cascadia vehicles with DT12 transmissions, built between 12/1/2024 and 1/25/2025.

Symptoms

These Vehicles could experience drivability issues, common complaint is sluggish throttle response and/or delayed shift.

Issue

It has been discovered that the TCM was incorrectly programmed with the wrong TCM05T parameter settings from the production plant.

Solution

Please program the TCM to OEM. Do not program any other modules. Do not upload to the server prior to programming as that may alter the parameters on server that have been setup to resolve this issue.

You may encounter a gear box not learned fault after programming. If the fault occurs, you'll need to learn the transmission.

Once this is done road test to verify operation.

If further assistance needed, please create a case over the web using the DTTS App on the DTNA Portal

Labels :

New Cascadia

Power Train

Add tags

 5 Kudos

Comment

Powered by
Khoros 