

02/17/2025

CAL FCC 47-002

Subject: Incorrect Fuel Tank Support Rods

Make: FCCC

Model: Tiffin XCR

Model Year Affected: 2024

Build Date Range: Selected Vehicles Built Between June 27, 2024 and June 27, 2024

Our records indicate that you are the owner of certain XCR vehicles and therefore, DTNA has decided to share the following documentation with you.

The fuel tank support rods installed on your vehicle may be incorrect and need to be replaced.

Please see the attached communication in this email. We hope you find this information helpful.

02/17/2025

CAL FCC 47-002

Subject: Replacing Fuel Tank Support Rods

Make: FCCC


Model: Tiffin XCR

Model Year Affected: 2024

Build Date Range: Selected Vehicles Built Between June 27, 2024 and June 27, 2024

Work Instructions

1. Park the vehicle, shut down the engine, and apply the parking brakes. Chock the tires.
2. Support the fuel tank cradle.
3. Remove the currently installed fuel tank support studs.
4. Install the correct studs, PN 03-25287-009, per drawing D03-44520-000. Install the upper end of the stud to the fuel tank support on the chassis rail and place the washer and fastener on top.

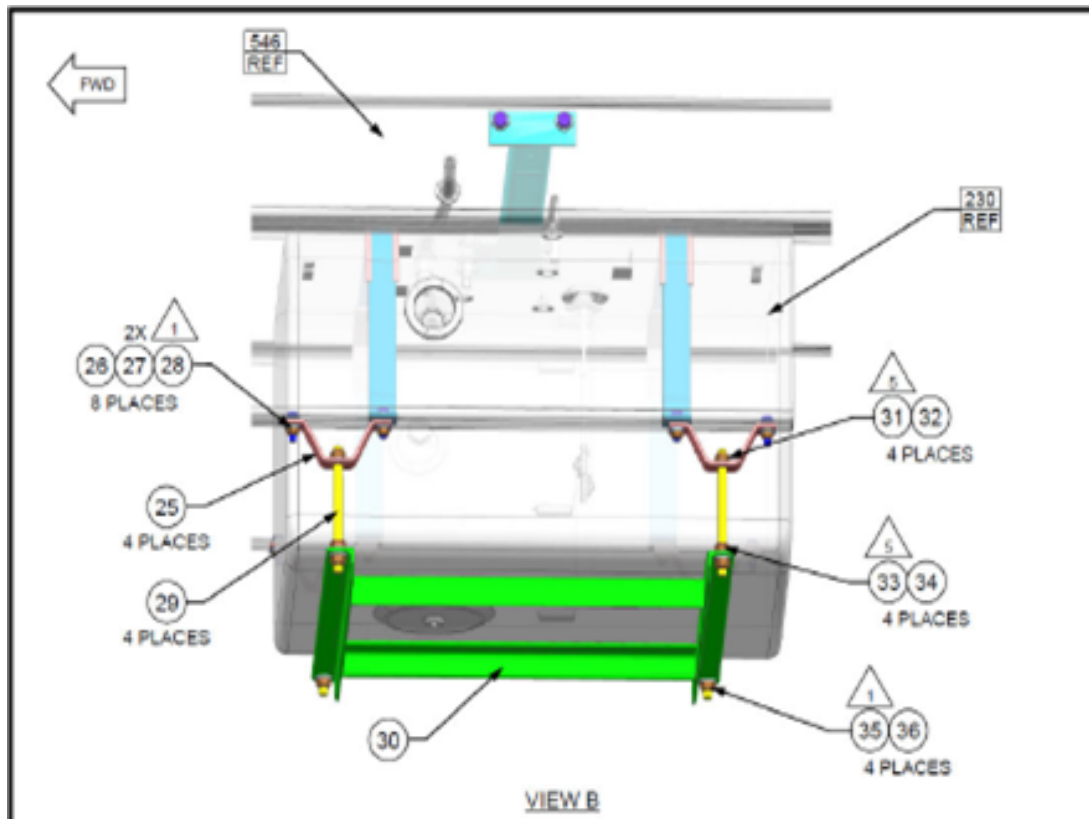

5. Place the fastener and washer onto the stud, then insert them through the fuel tank cradle.
6. Place the washer and fastener at the bottom of the stud and tighten the fastener 118 lbf·ft (160 N·m). Repeat this process at four places for each fuel tank support stud.