



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-25-18

Subject: Airbag Module Software Configuration. B201300- No Band End Programming Occurs Hotfix Instructions

Date: Feb. 12, 2025

Important:


We recommend installation of this hotfix on one diagnostic device ONLY. Hotfix must be removed immediately after performing the procedure.

1.0 – Introduction

The hotfix is for multiple vehicles:

- 2018-2025 BW-Tiguan
- 2018-2023 CA/CM-Atlas
- 2015-2021 AU-Golf
- 2022-2025 SD/CG-Golf
- 2022-2025 CL-Taos
- 2018-2025 BU Jetta

If you have the DTC: B201300: **No band end programming occurs**, and you attempt the test plan and get the error message below. This hotfix will address that.

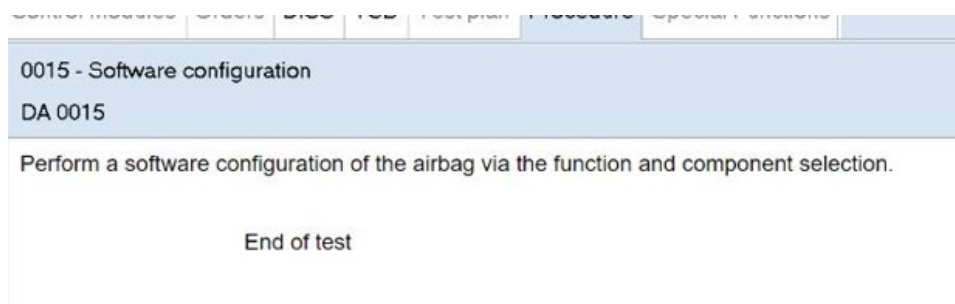

(continued)



Service Information

!! The Hotfix must be removed after performing the diagnostic procedure. !!


2.0 – Prerequisite


ODIS Service **latest Diagnostic Content version** must be installed.

To confirm the installed diagnostic content version in ODIS Service, go to:

Info >  Versions>Diagnostic data; didb_GFS-v.en_US: xxxxxxxx **X.XX.XX**

3.0 – Download Hotfix

1. Open a **Web Browser** on the diagnostic device and logon to **vwhub.com**
2. Navigate to **Elsa2Go>Service References>Software/Hardware Updates**
3. Search for the **SWK Hotfix Zip File**
4. Click the **SWK Hotfix Zip File**  and **save** it to your Windows desktop.
5. Close your browser.
6. Browse to the desktop and double-click the **SWK Hotfix Zip File** to open it.
7. Right click the file (example only) name and select **Copy**:

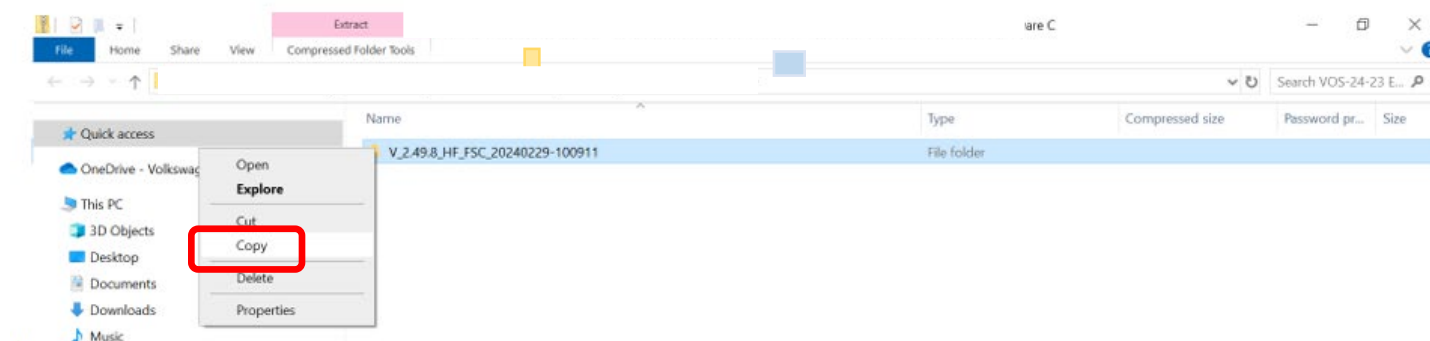


(continued)




Service Information

8. Right click anywhere on the Windows desktop and select **Paste**. This file icon (example) must appear on the desktop:

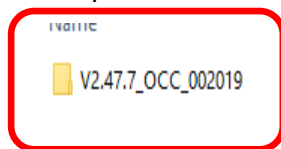


4.0 – Install Hotfix into ODIS Service

1. Open ODIS Service (“Run as Administrator”)
2. Expand the **Data** submenu and click **Download** (under **Hotfix**):

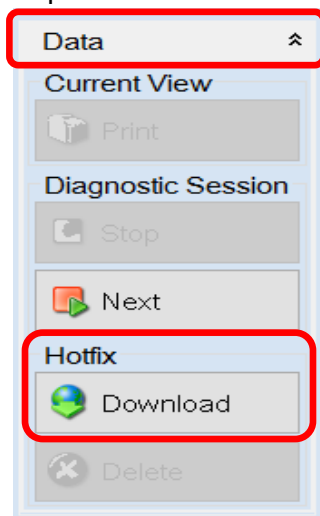

3. Click **Continue**:

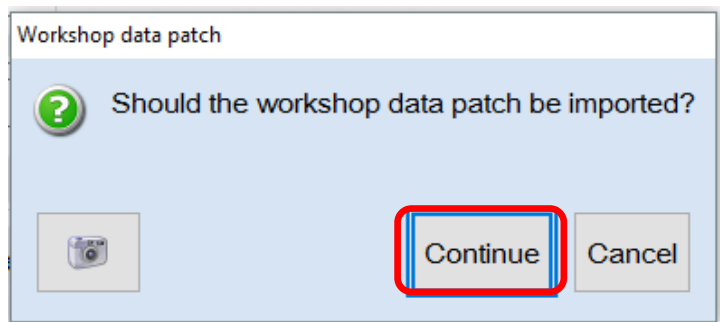


(continued)




Service Information

- The Directory selection window will appear. Browse to and **highlight the Hotfix file** (*example only*), then click **Select Folder**:

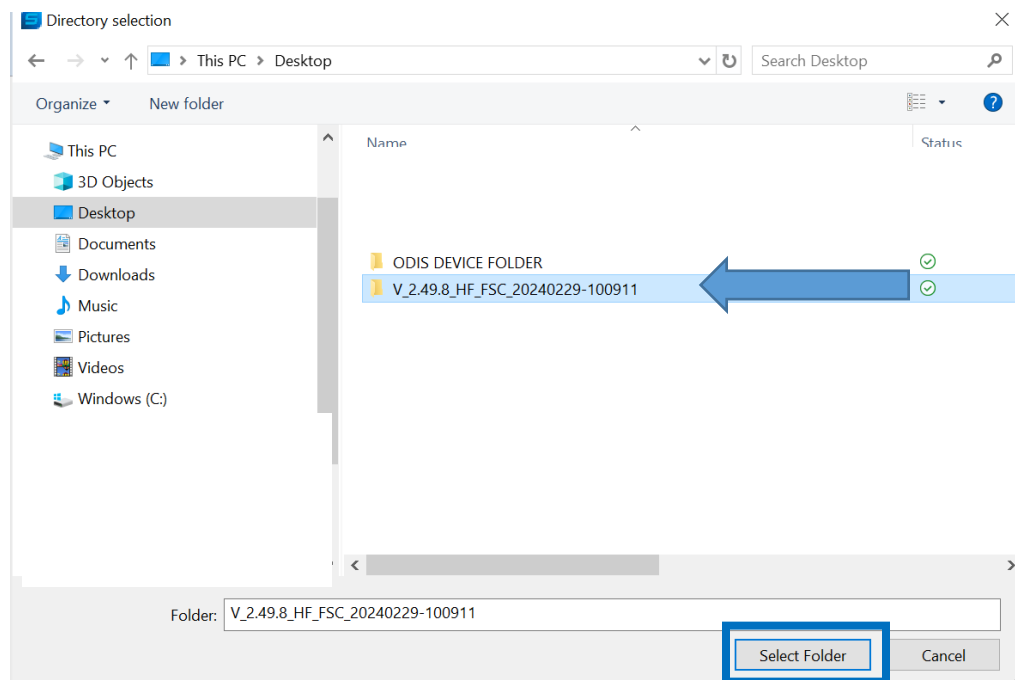

- Click **OK**:

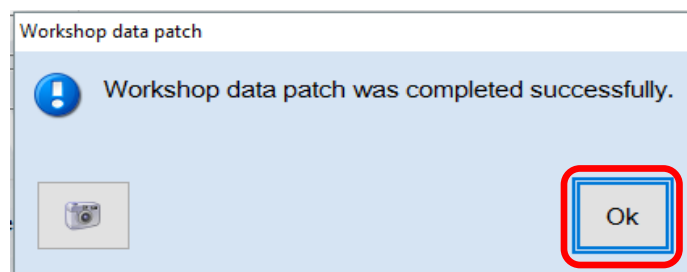

- Perform the diagnostic procedure.

Important:

The Hotfix must be removed after performing the procedure. Failure to do so will cause other vehicle diagnostics sessions to malfunction.


(continued)




Service Information

5.0 – Uninstall the Hotfix from ODIS Service

1. Select **Erase** (under Hotfix), then **Continue**:

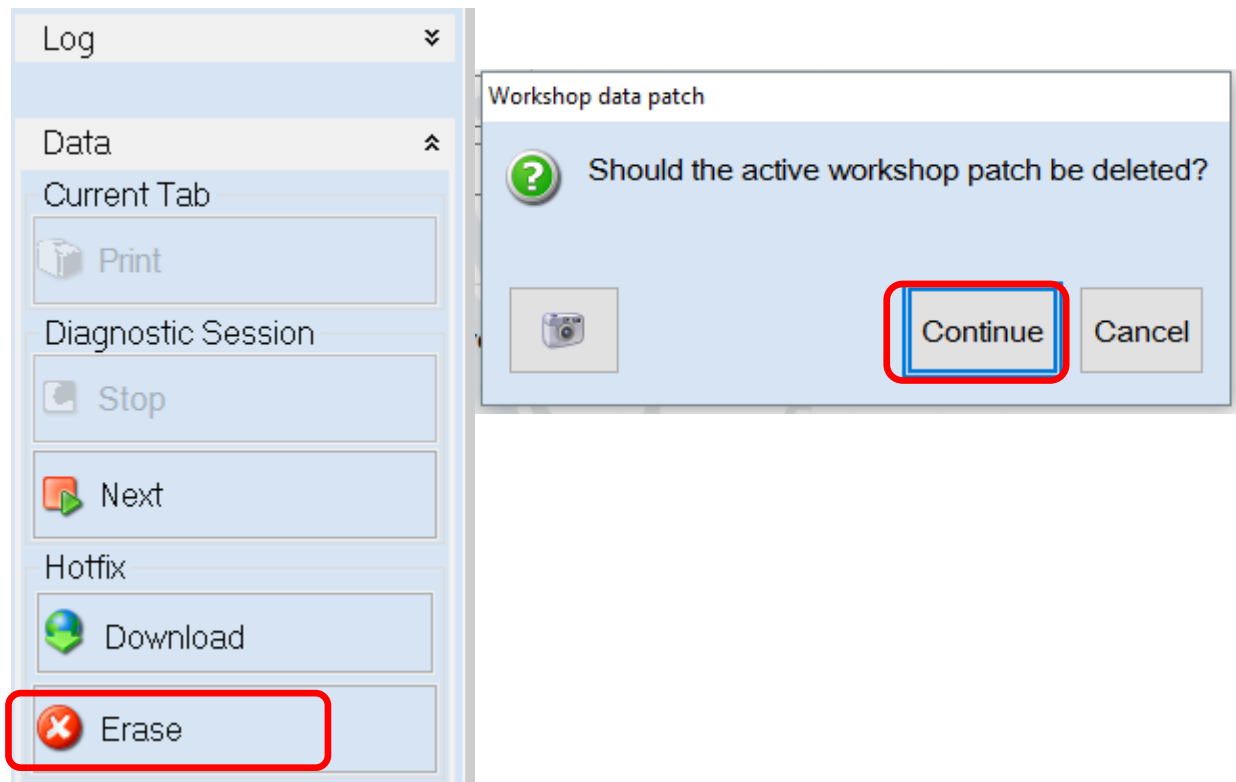

2. Click **OK** and close ODIS Service:

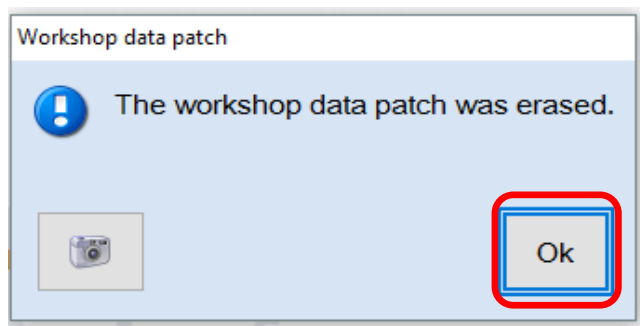

Please contact Diagnostic Tester Software Support by phone at 888-896-1298 or email softwaresupport@vw.com with any questions or concerns.