



Countries: CANADA, MEXICO, UNITED STATES
Availability: ISIS, FleetSIS, NotSIR
Major System: Electrical
Current Language: English
Other Languages: NONE
Viewed: 89

Document ID: IK0800678
Revision: 1
Created: 2/4/2025
Last Modified: 2/13/2025
Author: Sean McGannon

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 3	Not Helpful 0
----------------------	-------------------------------	----------------------------------------------------------	-----------------------------	------------------	-----------------------------	-------------------------	-----------------------------

Title: MV 04GBL Intellipark Won't Release With Door Open

Applies To: MVs with feature 04GBL Intellipark non-towing units.

CHANGE LOG

Please refer to the change log text box below for recent changes to this article:

02/07/2025 - Initial Article Release
02/13/2025 - Added Country Codes

DESCRIPTION

This document informs dealers and customers of a known issue on non-towing MVs equipped with feature 04GBL BRAKE, PARKING {Bendix Intellipark} Electronic Park Brake, for Truck or Bus Applications. If the operator of the vehicle attempts to release the parking brake with any door open it will not release. Currently, other Intellipark feature codes and other models of vehicles will display a warning in the instrument cluster screen that the parking brake will not release due to the door being open (Figure 1). On MVs with 04GBL, this message currently does not display. If the operator of the vehicle complains that the parking brake will not release verify all doors are closed, the service brake is applied, and the ignition key is on. A future software release will add this functionality to MVs with 04GBL.


Alert	Screen	Description
Park Brakes Not Released Check Door, WC Door		Park brake system interlock is not met. Check main access door and / or wheel chair access door (if equipped).

Figure 1: Warning Message in Cluster

SYMPTOM(s)

Customer Observations or Concerns:

Parking Brake will not release.

SPECIAL TOOL(s) / SOFTWARE

Not Applicable.

SERVICE PARTS INFORMATION

Not Applicable.

ADDITIONAL DIAGNOSTIC STEP(s)

The door switch signals can be monitored in DLB if they are believed to be malfunctioning and causing this complaint. Signal Door_Switch should be 0 with all doors closed. Door_Position_Signal will be 2 with all doors closed.

WARRANTY INFORMATION

Warranty Claim Coding:

Refer to the [Warranty Coding Manual](#) for Group and Noun Codes.

Standard Repair Time(s):

Refer to the [SRT Manual](#) for Repair Times

OTHER RESOURCES

[Master Service Information Site](#)

 Hide Details

Feedback Information

Viewed: 88

Helpful: 3

Not Helpful: 0

No Feedback Found
