

Reference	SSM76261
Models	New Range Rover / L460 New Range Rover Sport / L461
Title	Headlamp Washer Jet(s) Leaking
Category	Electrical
Last modified	05-Feb-2025 00:00:00
Symptom	202000 Wiper/Washer System
Attachments	Attachment_1.0.JPG (Attachment_1.0.JPG)

Content

Model / Model Year / Derivative

RANGE ROVER L460 / 22MY Onwards / All
RANGE ROVER SPORT L461 / 23MY Onwards / All

Situation:

JLR Engineering investigations have identified reports of the headlamp washer jet(s) leaking.

Action:

Refer to the service information below.

Service Information:

Before following the service instruction below, complete the following steps.

1. Confirm the customer symptom is present.
2. Identify the source of the leak.

If it **IS** one or both of the headlamp washer jets, continue with the service instruction below.

If it **IS NOT** one or both of the headlamp washer jets, continue with your diagnosis and do not continue with the service instruction below.

Service Instruction:

To assist Engineering with determining the root cause follow the below actions:

1. Replace the headlamp washer jet(s) and retain the part(s) in line with H.1.3 - Displaced Parts Disposal guidance within the Warranty Manual.
2. Record the date code from the headlamp washer jet housing(s), see attachment_1.0 to locate the date code. Date code format is DDMMYY (Double digit including leading zero), e.g. 231123.
3. Raise an Electronic Product Quality Report (ePQR), which must include the below information:
- Reference to BES_305

- Reference to P395613
- Reference to this SSM 76261
- Headlamp washer jet date code(s)
- An image of the date code(s) from the headlamp washer jet housing(s)
- Confirmation on which headlamp washer jets were replaced (Left or Right Hand or Both).

4. Update the EPQR to detail all completed actions.

(Ref 000395613 / 3954)

anBhdHfRknM7MjAyNS0wM0wNVQxNToyOTo0OS41MDBaOzE2NS4yMjUuMzkuOTs=