



## **SSM 53469 2022-2024 Expedition/Navigator - Liftgate Spoiler Contacting Roof In Freezing Temperatures**

Some 2022-2024 Expedition/Navigator vehicles may exhibit the liftgate spoiler contacting the roof during freezing temperatures when ice is present. This may be due to an insufficient margin between the liftgate spoiler and the roof at the roof center line area. To correct the condition, repair the spoiler and roof per Workshop Manual, Section 501-03/501-28. Make sure that the margin between the liftgate spoiler and the roof is a minimum of 6.5 mm at the roof centerline after liftgate adjustment. For claiming, use causal part 7844210 and applicable labor operations in Section 12 of the Service Labor Time Standard (SLTS) Manual.