

2025-03-10

☐

THIS REPAIR IS MOBILE FRIENDLY

MODEL


E-Series	Model Description	Production Date
G01	X3 Sports Activity Vehicle	ALL
G02	X4 Sports Activity Vehicle	

SITUATION

Customer states that the steering wheel heating is inoperative. Fault code “30490 Missing LIN slave” is stored in Body Domain Controller.

CAUSE

A poor connection is present for the KL31 circuit located at the component Steering Wheel Module connector X434*1B pin 11.

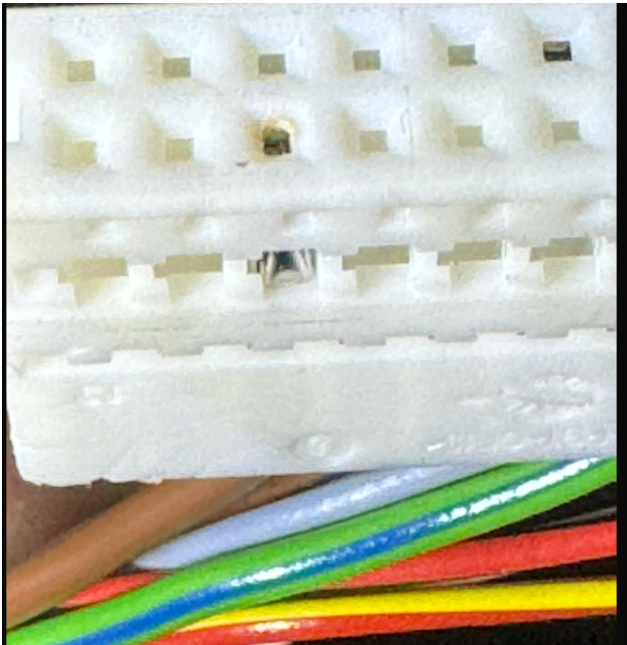

Example photo of visual findings for Steering Wheel Module connector X434*1B pin 11 with poor contact.

CORRECTION

Perform the wiring repair and replace the terminal and connector as needed.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
--------------------	---

