



Bulletin No.: PIT6206A
Published date: 03/7/2025

 
Preliminary Information

PIT6206A Diagnostic Tip - Rattle/Squeak/Creak/Squawk/Itch/Buzz/Rub/Vibration Type Noise Heard From The Dash I/P or Center Console Area

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet	Silverado 1500	2024 - 2025	All	All L84 or L87	All
GMC	Sierra 1500	2024 - 2025	All	All L84 or L87	All

Involved Region or Country	North America
Additional Options (RPO)	L84/L87 and FJW
Condition	<p>Some customers may comment of a rattle, squeak, creak, itch, buzz, vibration, or rub type noise heard from the IP dash, drivers floor, accelerator pedal, or center console area.</p> <p>The noise may be duplicated by the following:</p> <ul style="list-style-type: none">- Driving over small bumps at slower speeds- During acceleration- Brake torquing- When engine goes into AFM mode
Cause	The cause of this noise could be the bank 1 sensor 1 O2 sensor connector contacting the body / floor, as shown below.



Correction:
Inspect the bank 1 sensor 1 O2 sensor connector for contact to the body/floor.

If contact is found, then make sure the connectors' plastic retainer is fully installed/seated in the mounting tab hole, this will hold the connector away from the body.

Version History.

Version	2
Modified	7/19/2024 - Created. 03/07/2025 - Update to the models, title, and condition sections.