



SSM 53487 2023-2025 F-Super Duty, 2023-2026 F-650/F-750 - 6.7L - Illuminated MIL With DTC P0384

Some 2023-2025 F-Super Duty and 2023-2026 F-650/F-750 vehicles may exhibit an illuminated malfunction indicator light (MIL) with diagnostic trouble code (DTC) P0384 stored in the powertrain control module (PCM). This may be due to an intermittently stuck closed glow plug relay to the glow dosing module (GDM)/secondary on-board diagnostic control module (SOBDMC). To correct the condition, replace the glow plug relay, service part number F8OZ-14N089-AA. If the condition returns, refer to Workshop Manual (WSM), Section 303-07 for normal diagnostics. For claiming, use causal part 14N089.