

Technical Service Bulletin (TSB)
Passenger Seatbelt Inertial Locking System Is Too Sensitive

REFERENCE:	TSB: 10-002-25 REV. A GROUP: 23 - Body	Date:	March 21, 2025	REVISION:	10-002-25
VEHICLES AFFECTED:	2025 - 2026 *(B1) Jeep Renegade* 2025 - 2026 (M1) Jeep Compass This bulletin applies to vehicles built on and after January 02, 2025 (MDH 0102XX) and on and before February 08, 2025 (MDH 0208XX).			MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> CH <input type="checkbox"/> EE <input type="checkbox"/> IAP <input checked="" type="checkbox"/> SA <input type="checkbox"/> MEA Not For US and Canada	
CUSTOMER SYMPTOM:	The customer may comment on the following: <ul style="list-style-type: none"> • Passenger Seatbelt Inertial Locking System is too sensitive. 				
CAUSE:	Belt deformation				

This bulletin supersedes Technical Service Bulletin (TSB) 10-002-25, date of issue March 18, 2025, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include a corrected vehicle model and updated Spare Parts Table and Repair procedure text.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-033, date of issue March 18, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting the right side seat belt operation and possibly replacing it if needed.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
23-13-03-97	Belt, Seat - Inspect (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
23-13-03-98	Belt, Seat - Inspect And Replace (0 - Introduction)	6 - Electrical and Body Systems	0.8 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	8AV41LXHAA - MOPAR 7097973 - EMEA	Belt, Seat	Right ** (Renegade)**
1 (AR)	8AV44DX9AA - MOPAR 7097974 - EMEA	Belt, Seat	Right ** (Compass)**

DIAGNOSIS:

If the customer describes any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Inspect ****the rear**** right side seat belt by pulling it from resting position forward 10 times.
2. Does the seat belt lock or hang up when being pulled?
 - YES >>> Proceed to [Step 3](#).
 - NO >>> This bulletin has been completed. Use Inspection LOP (23-13-03-97) to close the active RSU.
3. Replace the seat belt assembly. Refer to the detailed service procedures listed in DealerCONNECT> Service Library under: 7065B12 - Cinto de segurança traseiro com tres pontos (um) - esq. ou dir. - remocao/recolocacao.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.