



# TECHNICAL SERVICE BULLETIN

Classification: EC24-018	Reference: NTB25-008	Date: March 20, 2025
-----------------------------	-------------------------	-------------------------

## "ENGINE MALFUNCTION POWER REDUCED SERVICE NOW" DISPLAYED IN COMBINATION METER

**APPLIED VEHICLES:** 2021-2023 Rogue (T33)  
**APPLIED DATES:** Built on or before September 27, 2024  
**APPLIED ENGINES:** KR15DDT

### IF YOU CONFIRM

The customer states that a "Engine Malfunction Power Reduced Service Now" warning is being displayed, or was displayed in the past,

OR

DTC P0404 for "EGR A CONTROL" is stored as "Past" or "Current" in the ECM.

### ACTION

Refer to the **SERVICE PROCEDURE** in this bulletin to:

1. Confirm the current ECM part number.
2. Reprogram the ECM, if applicable.

**IMPORTANT:** The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## SERVICE PROCEDURE

1. Using CONSULT, confirm the current ECM part number and write it on the repair order.
  - If it matches one of the part numbers in **Table A**, continue to step 2 on page 3.
  - If it does not match one of the part numbers in **Table A**, this bulletin does not apply. Go back to ASIST for further diagnostic and repair information.

**Table A**

MODEL	CURRENT ECM PART NUMBER: 23761-
2021 Rogue	6RK0D, 6RK0E, 6RK1D, 6RK1E, 6RK2D, 6RK2E, 6RK3D 6RK3E, 6RN3A, 6RN3B, 6RN3C, 6RN4A, 6RN4B, 6RN4C 6RN5A, 6RN5B, 6RN5C, 6RN6A, 6RN6B, 6RN6C, 6RN7A 6RN7B, 6RN8A, 6RN8B, 6RV8A, 6RV8B, 6RV8C, 6RV9A 6RV9B, 6RV9C
2022 Rogue	4MN3A, 4MN3B, 4MN3C, 4MN3D, 4MN3E, 4MN4A, 4MN4B 4MN4C, 6RC1A, 6RC1B, 6RC2A, 6RC2B, 6RD1D, 6RD1E 6RD2D, 6RD2E, 6RD3D, 6RD3E, 6RD4D, 6RD4E, 6RL1B 6RL1C, 6RL1D, 6RL1E, 6RL2B, 6RL2C, 6RL2D, 6RL2E, 6RL3B 6RL3C, 6RL3D, 6RL3E, 6RL4B, 6RL4C, 6RL4D, 6RL4E 6RS8A, 6RS8B, 6RS9A, 6RS9B, 6RV4A 6RV4B, 6RV4C, 6RV5A, 6RV5B, 6RV5C, 6RV6A, 6RV6B 6RV6C, 6RV7A, 6RV7B, 6RV7C
2023 Rogue	4MN5A, 4MN5B, 4MN5C, 4MN5D, 4MN6A, 4MN6B, 4MN6C 4MN6D, 4MT2A, 4MT2B, 4MT2C, 4MT2D, 6RJ0A, 6RJ0B 6RJ0C, 6RJ0D, 6RJ0E, 6RJ1A, 6RJ1B, 6RJ1C, 6RJ1D, 6RJ1E 6RJ2A, 6RJ2B, 6RJ2C, 6RJ2D, 6RJ2E, 6RJ3A, 6RJ3B, 6RJ3C 6RJ3D, 6RJ3E, 6RL5B, 6RL5C, 6RL5D, 6RL5E, 6RL6B, 6RL6C 6RL6D, 6RL6E, 6RL7B, 6RL7C, 6RL7D, 6RL7E, 6RL8B, 6RL8C 6RL8D, 6RL8E, 6RV0A, 6RV0B, 6RV0C, 6RV0D, 6RV1A 6RV1B, 6RV1C, 6RV1D, 6RV2A, 6RV2B, 6RV2C, 6RV2D 6RV3A, 6RV3B, 6RV3C, 6RV3D, 6RX1A, 6RX1B, 6RX1C 6RX1D, 6RX2A, 6RX2B, 6RX2C, 6RX2D, 6RX3A, 6RX3B 6RX3C, 6RX3D, 6RX4A, 6RX4B, 6RX4C, 6RX4D

**⚠ WARNING ⚠ CAUTION NOTICE**

If you are not familiar with the reprogramming procedure, refer to the Electronic Service Manual (ESM) and the CONSULT Operation Manual to reprogram the Electronic Control Unit (ECU). Follow all precautions in both manuals to prevent possible personal injury or death and/or damage to the ECU.

2. Reprogram the ECM.

**HINT:** If required, perform "ADDITIONAL SERVICE" per the ESM.

3. After completing **Erase All DTCs**, print a copy of the CONSULT screen showing the before and after part numbers of the control unit and attach it to the repair order.

### CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Reprogram ECM	(1)	DE97AA	ZE	32	(2)

- (1) Reference the electronic parts catalog and use the ECM (23703-\*\*\*\*\*) as the Primary Failed Part (**PFP**).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (**FRT**).

### AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
March 20, 2025	NTB25-008	Original bulletin published