



**Bulletin No.:** PIT6325B

**Published date:** 03/18/2025

## Preliminary Information

### PIT6325B Forward Collision Unavailable Message and Supercruise inoperative With DTC U3000 SYM 44 or 54

#### Models

<b>Brand:</b>	<b>Model:</b>	<b>Model Years:</b>	<b>VIN:</b> from to	<b>Engine:</b>	<b>Transmissions:</b>
Cadillac	Escalade IQ	2025	All All All	All	All

<b>Involved Region or Country</b>	North America
<b>Additional Options (RPO)</b>	UGN or UKL
<b>Condition</b>	Supercruise Inoperative and Forward Collision Unavailable Message with the following DTC Pattern.  U3000 SYM 44 set as a current code and U3000 SYM 54 set as a history code.
<b>Cause</b>	The forward camera in windshield being blocked by snow, ice, or fog over multiple key cycles.

#### Correction:

New software has been released to correct this condition that resides within the B174W Forward Camera Module. Perform a vehicle wide programming update per TSB [24-NA-143](#): Software Update on Ultium Vehicles


#### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
Follow TSB <a href="#">24-NA-143</a>	Software Update on Ultium Vehicles	Use Published Time in Bulletin

#### Version History

<b>Version</b>	<b>3</b>
<b>Modified</b>	<b>01/23/2025 - Created on.</b> <b>02/25/2025- Updated Correction.</b> <b>03/18/2025- Update labor time description</b>

 GM Global Brands

© 2025 General Motors. All Rights Reserved.