



Bulletin No.: PIC6599

Published date: 03/19/2025

Preliminary Information

PIC6599 Front Grill Trim Fitment - Front Fascia Popped Out

Models

 
Brand: Model: Model Years: VIN: Engine: Transmissions:
from to
 Cadillac OPTIQ 2025 All All All All

Involved Region or Country	North America
Condition	<p>Customer may comment that the front fascia/bumper trim is coming apart.</p> <p>The technician may find the front bumper fascia is bowed out on one or both sides.</p> <p>Looks like it's trim is hitting the headlamp assembly.</p>
Cause	Front fascia trim is not fully installed onto fascia.

Correction:

Inspect front fascia and confirm that the following condition exists.

RH side shown below.




To repair this condition, the tech will need to remove the 4 fasteners location at the top of the fascia, see image below.



Using a trim stick tool, gentle pry upwards.



Pull top of fascia forward.

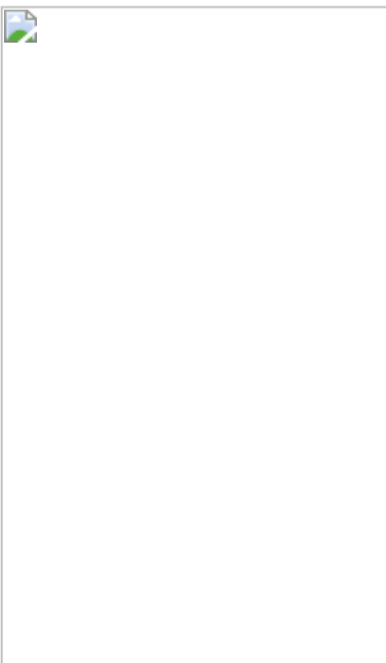

With the affected trim exposed, inspect for the trim lock tabs.



If the retaining tabs are not fully locked into the fascia, using hand pressure only, lock them into place.



Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
* 1080007	Re-engage fascia clips	0.3 Hrs.

Labor Operation	Description	Labor Time
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	03/19/2025 - Created.

 GM Global Brands

© 2025 General Motors. All Rights Reserved.