



Bulletin No.: PIT6354

Published date: 03/20/2025

Preliminary Information

PIT6354 Information on Door Chimes and Dome Lamps Inoperative, Radio Stays on When Door is Opened, Power Mirrors inoperative or the Driver Mirror is Distorted

Models

Brand:	Model:	Model Years:	VIN:	Engine:	Transmissions:
Chevrolet Blazer		2019 - 2025	from to All All All		All

Involved Region or Country	North America
Condition	Some customers may comment that the door chimes and dome lamps are inoperative, the radio stays on when the door is opened, power mirrors are inoperative, or the driver mirror is distorted.
Cause	Possible water intrusion into X500 or X600 due to water leaking past the A pillar body plug.

Correction:

Repair corrosion in connector- replace damaged terminals with terminated leads if necessary.

Install a new body plug and apply a sealant to prevent future water intrusion. Refer to SI for the proper procedures and Labor operations as needed.

Warranty Information

Version History

Version	1
Modified	03/20/2025 - Created on.

GM Global Brands

© 2025 General Motors. All Rights Reserved.