



SSM 53521 2023-2025 F-Super Duty - DTCS U023A:00, U0159:00, And/Or U0146:00 Setting In The ABS Module After Remote Starting

Some 2023-2025 F-Super Duty vehicles may set diagnostic trouble codes (DTCS) U023A:00, U0159:00, and/or U0146:00 in the anti-lock brake system (ABS) module after the vehicle is remote started. This may be due to the image processing module A (IPMA) not communicating on the controller area network (CAN) during the remote starting event. Replacement or reprogramming of the ABS module or IPMA will not resolve this condition. U023A:00, U0159:00, and/or U0146:00 should be ignored if no other DTCS are present in the ABS module and no customer symptoms are present. The presence of these DTCS does not affect vehicle operation. No further service action is required.