



Bulletin No.: PIP5950A
Published date: 03/26/2025

Preliminary Information

PIP5950A L8T - MKM Setting P060C P060D

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2500HD	2024 - 2025	All	ALL	L8T	MKM
Chevrolet	Silverado 3500HD	2024 - 2025	All	ALL	L8T	MKM
GMC	Sierra 2500HD	2024 - 2025	ALL	ALL	L8T	MKM
GMC	Sierra 3500HD	2024 - 2025	ALL	ALL	L8T	MKM

Involved Region or Country	Asia/Pacific, Australia, Europe, Israel, North America, Middle East Operations, & Palestine
Condition	DTC P060C and/or P060D setting in the TCM after/during an attempted Service Fast Learn.
Cause	TCM software anomaly.

Correction :

Clear the DTC.

Do not replace the TCM.

Do not attempt the SFL.

Complete the "Transmission Adaptive Pressure Reset" procedure in GDS2.

If the trans is operating as designed with no DTCs setting, return the vehicle to the customer.

**** Note ** This concern is being investigated, P/I will be deleted or update into a TSB as needed.**

Version History

Version	2
Modified	11/14/2023 - Created on. 03/26/2025 - Updated to add the 2025 model year.