



**Bulletin No.:** PIT6218B  
**Published date:** 03/31/2025

## Preliminary Information

### PIT6218B SES light P059F

 
#### Models

<b>Brand:</b>	<b>Model:</b>	<b>Model Years:</b>	<b>VIN: from to</b>	<b>Engine:</b>	<b>Transmissions:</b>
Buick	Enclave	2025	All	All All	All
Chevrolet	Traverse (All New)	2024 - 2025	All	All LK0	All
GMC	Acadia	2024 - 2025	All	All All	All

<b>Involved Region or Country</b>	<b>North America</b>
<b>Condition</b>	<b>SES light on with code P059F set for active grill shutter malfunction.</b>
<b>Cause</b>	<b>Possible bent hood support front bumper bracket.</b>

#### **Correction:**

**Before replacing the grill shutter inspect the bracket in front of it for being bent as shown below.**





If the bracket is bent, remove the bracket and command the shutter with GDS2.  
If the shutter will move when commanded replace the bracket only.  
If the shutter does not move or does not move smoothly, replace the bracket and shutter.  
See the photo below of a good bracket for comparison.



If the bracket is not bent follow SI diagnostics for the code.


### **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
* 2087078	Bent Bracket Replacement for P059F	1.1
*This is a unique Labor Operation for Bulletin use only.		

**Version History**

<b>Version</b>	3
<b>Modified</b>	<b>08/19/2024 - Created on.</b> <b>01/13/2025- Updated model years.</b> <b>3/26/25- Updated to add labor operation</b>

 GM Global Brands

© 2025 General Motors. All Rights Reserved.