

eM2 Discharge Line Interference with Equalizer

Field Service Campaign SF-712

Planned Publish Date: 3/14/2025

Problem Details:

- Wirebraid hose section of air compressor discharge line may contact equalizer, and could eventually rub through

FSPRs, FRACAS, DPR, Zeus:


- FSPRs 39292, 39301

Affected Models / Truck options:

- Affected vehicles eM2 built with 131-C22306, prior to changeover of EWR P66101
- Population of affected vehicles: 107

Responsible Supplier:

- N/A

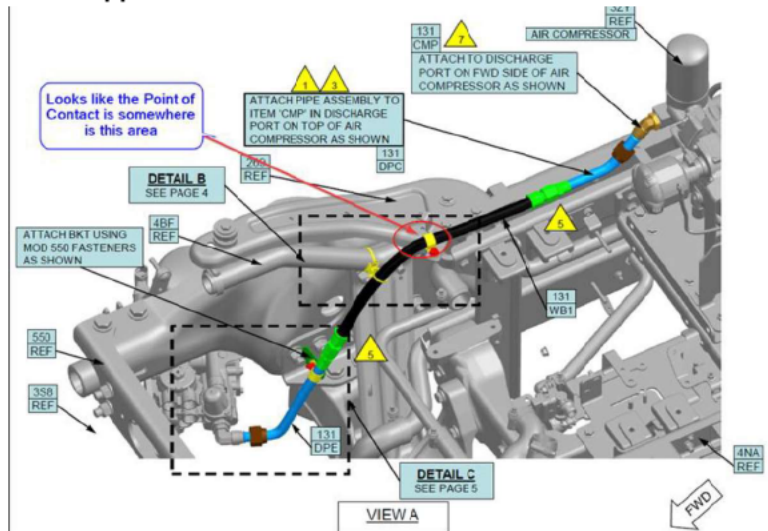

Production Containment:

☒ No ☐ Yes

- Issue was identified during pre-series (3/7/2022, ref Shopcall 533330 & 548997)
 - Plant, ME, and Engineering could not confirm condition was reliably corrected until 5/13/2024 changeover of P66101

Field Containment (short term):

☒ No ☐ Yes

- None – fix as fail

Root Cause:

☐ No ☒ Yes

- Design error

Long Term Corrective Action Plan:

☐ No ☒ Yes

- EWR P66101 released new discharge line design with added clearance to equalizer
- Production changeover: 5/13/2024

☐ No ☒ Yes

Long Term Field Plan:

- Field Service Campaign SF-712

- Inspect new design



Q-Meeting