



## STAR ONLINE PUBLICATION



**Case Number:** S2523000015 Rev. A

**Release Date:** April 2025

**Symptom/Vehicle Issue:** Replacement Exterior Mirror Glass Connector Does Not Match For Blind Spot.

**Discussion:** During 2024 production there was an engineering change on exterior mirrors. The glass blind spot indicator changed. The “early mirror glass” design with the early blind spot is no longer available in MOPAR, however there is a “new mirror glass” design with the new blind spot monitor indicator for all the model years for production and service. This “new mirror glass” has a different connector for the blind spot indicator. An adapting jumper harness has been created to allow installation of the new mirror glass to the early mirror wiring with the new blind spot glass.

**Part Information:** Jumper Part number: 68673054AA.

<<<**NOTE**>>>Review the below repair information completely prior to ordering.

**Repair:** Remove the exterior mirror glass from the door mirror assembly. Compare the connections to the images below. Fig 1 shows an early design mirror that will require the adapter jumper harness. Fig 2 shows the new mirror glass design that does not require an adapter jumper harness.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.**



## STAR ONLINE PUBLICATION

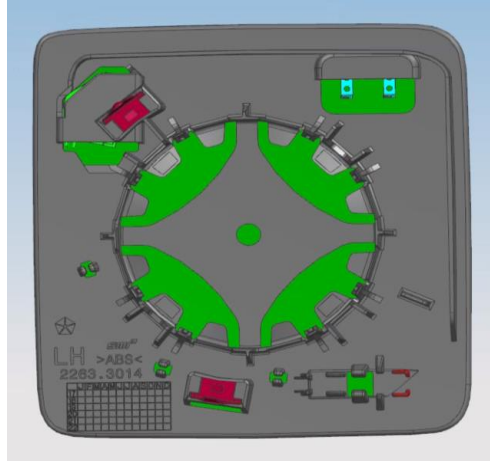


Fig 1.

### Early Mirror Glass Design

Requires Adapter Jumper Harness When Installing New Design Mirror Glass.

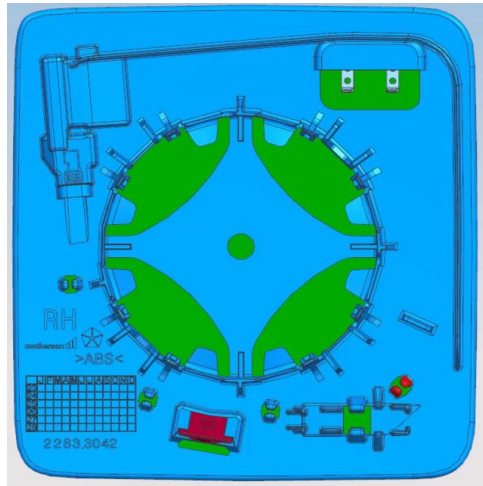


Fig 2.

### New Mirror Glass Design Adapter Jumper Not Needed.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.**



## STAR ONLINE PUBLICATION



- If you have an old mirror and need replacement glass (Fig 1) – order a service glass + a JUMPER to allow a connection to the old mirror wiring. Jumper 68673054AA
- If you have a new mirror that needs replacement glass (Fig 2) – order a service glass only - no jumper needed.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.**