



SIB 34 01 25

2025-03-27

DELIVERY STOP: EMF ACTUATOR (PARKING BRAKE ACTUATOR)

This Service Information Bulletin (Revision 1) replaces SI B34 01 25 **dated February 2025**.

What's New:

- SIB subject revised
- Situation revised
- Cause added
- Correction added
- Procedure added
- Parts Information added
- Claim Information added

<input type="checkbox"/>	THIS REPAIR IS MOBILE FRIENDLY
<input type="checkbox"/>	THIS REPAIR IS REMOTE SOFTWARE UPGRADE (RSU) FRIENDLY

MODEL

E-Series	Model Description	Production Date
G60	5 Series Sedan & i5 Sedan	January 16, 2025 – January 29, 2025
G70	7 Series Sedan	January 15, 2025 – February 4, 2025
G90	M5 Sedan	January 13, 2025 – January 30, 2025

AFFECTED VEHICLES

Vehicles which require this campaign to be completed will show it as “Open” when checked either in AIR, AWP, Campaign Summary or Warranty Vehicle Inquiry.

Please make sure you check your dealer inventory as soon as possible. As of February 22, 2025, you can see a list of affected vehicles in Inventory Campaign Details (ICD) under ROSS.

SITUATION

BMW AG has issued a Delivery Stop (effective February 21, 2025) on a small number of Model Year 2025 BMW vehicles that were produced between January 13, 2025, and February 4, 2025.

Do not deliver to a customer, a New, Certified Pre-Owned or Used vehicle subject to a Delivery Stop, until the vehicle is repaired. Do not use or sell replacement equipment/parts subject to a Delivery Stop.

The parking brake actuator cannot be activated or deactivated due to a failed weld.

Check Control message “Parking brake failed. When parking, secure the vehicle against rolling away. Must be checked by the Service Partner.”

The vehicle is still held by the unaffected side and the transmission lock.

CAUSE

Manufacturing error of the parking brake actuator.

CORRECTION

Replace the right parking brake actuator.

PROCEDURE

Replace the right parking brake actuator as per REP 34 52 162.

PARTS INFORMATION

Use and invoice the part numbers below.

Part Number	Description	Quantity
34 20 8 843 108	Repair kit EMF actuator right	1
34 20 8 846 401	Repair kit O-ring	1

CLAIM INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the applicable work package information below, and the part numbers listed above.

Repair Code:	0034130300	---
---------------------	-------------------	-----

Below are the special flat rate labor operation code choices for this action.

Completion before the first vehicle delivery to a customer (New in-stock/No in-service date), or the vehicle is already in the workshop for another reason and/or repair.

Work Pkg	Labor Operation	Description (Plusposition)	Labor Allowance
# 1	00 78 559	Renew right EMF actuator	3 FRU

Or:

The vehicle arrives at your center and this Action shows open (No other Main work will be performed or claimed during this workshop visit).

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 2	00 78 050	Renew right EMF actuator	5 FRU

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

Claim Repair Comments

Only reference the SIB number and the work package (Pkg) number performed in the technician's RO notes and in the claim comments (For example: B34 01 25 WP 1), unless otherwise required by State law.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

