



Service Information

Offboard Diagnostic Information System Service (ODIS Service) Number: AOS-25-16

Subject: 2023 Q4 eTron VKMS Adaption Test Hotfix Instructions Date: March 28, 2025

Supersedes AOS-25-15 due to instructions addition.

To All Dealer Partners,

This hotfix is for the: **2023 Q4**

 The tester must be on Base Application 24.3.2 and Audi Brand version 2.37.5

Concern:

- 08 – A/C heater electronics / Climatronic control module replacement test says it could not complete the VKMS adaptation. VKMS (Vehicle Key Management System) adaptation test also fails.

Solution:

- We already fixed this problem. Please use the hotfix 'A_2.37.5_hf_vkms_005f_20250321-103643.zip'. Note, this hotfix will only work on testers using Audi Brand version 2.37.5.

Important:


We recommend installation of this hotfix on one diagnostic device ONLY. Hotfix must be removed immediately after performing the procedure.




Service Information

1.0 Download Hotfix

1. Open a **Web Browser** on the diagnostic device and logon to **AccessAudi.com**
2. Navigate to **Elsa2Go>Service References>Software/Hardware Updates**
3. Search for **AOS-25-16 Q4 eTron VKMS Adaption Zip File**
4. Click the **AOS-25-16 Q4 eTron VKMS Adaption Zip File**  and **save** it to your Windows desktop.
5. Close your browser.
6. Browse to the desktop and double-click the **HF+VKMS Zip File** to open it.
7. Right click the file (example only) name and select **Copy**:

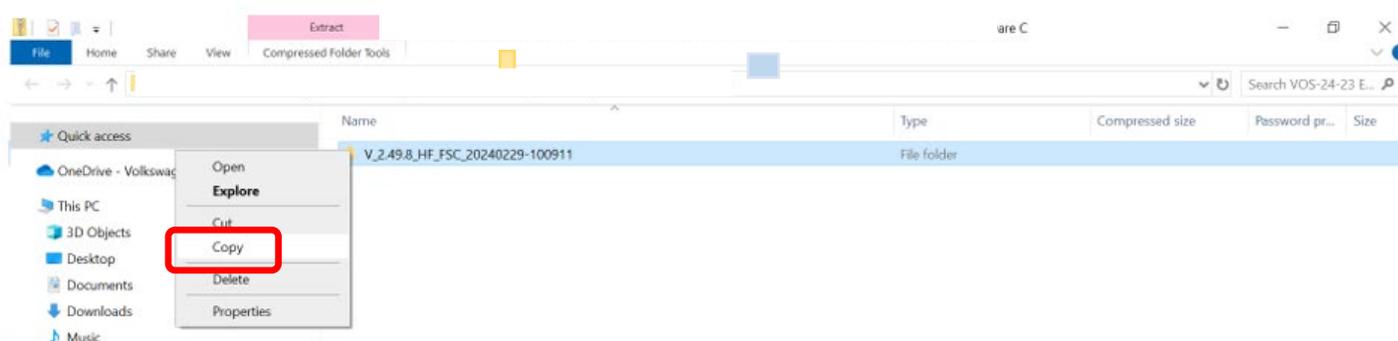

8. Right click anywhere on the Windows desktop and select **Paste**. This file icon (example) must appear on the desktop:

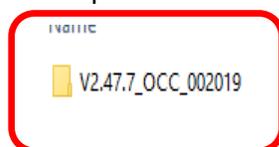


(continued)




Service Information

2.0 – Install Hotfix into ODIS Service

1. Open ODIS Service (“Run as Administrator”)
2. Expand the **Data** submenu and click **Download** (under **Hotfix**):

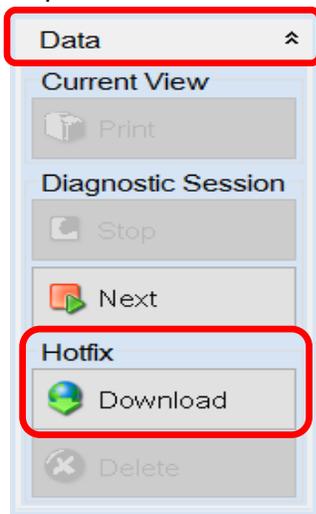


3. Click **Continue**:

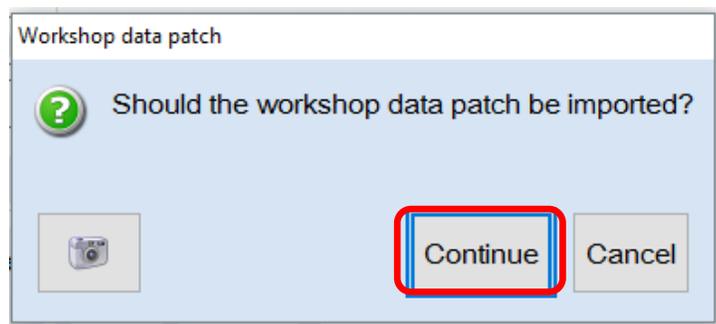




Service Information

- The Directory selection window will appear. Browse to and **highlight the Hotfix file** (*example only*), then click **Select Folder**:

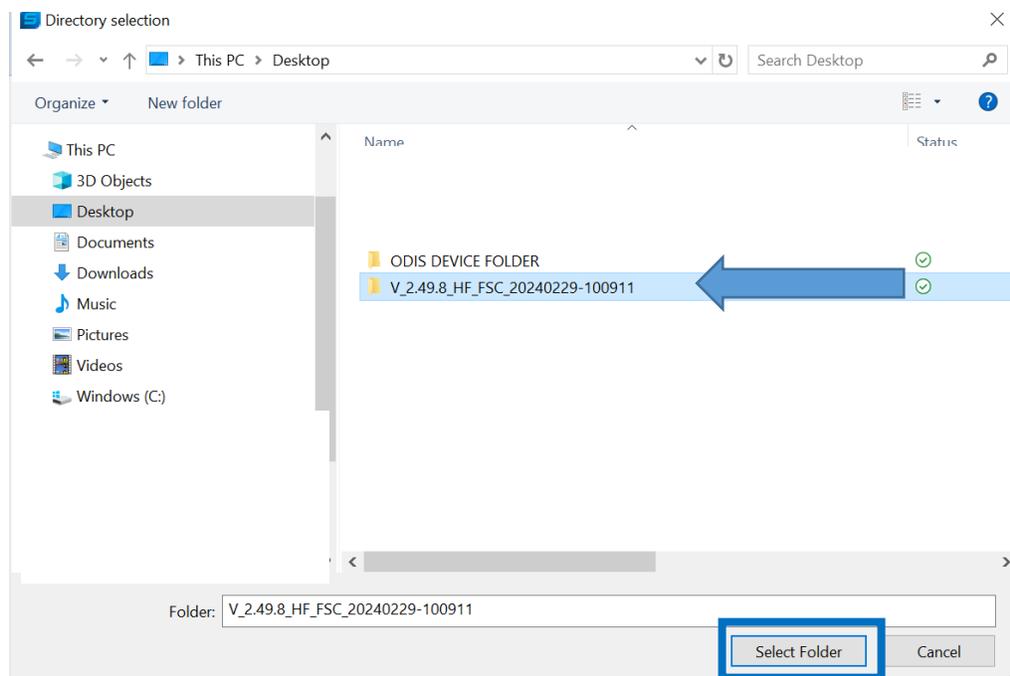

- Click **OK**:

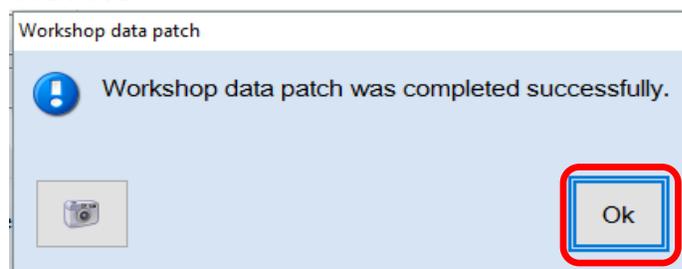

- Perform the diagnostic procedure.

Important:


The Hotfix must be removed after performing the procedure. Failure to do so will cause other vehicle diagnostics sessions to malfunction.




Service Information

3.0 – Uninstall the Hotfix from ODIS Service

1. Select **Erase** (under Hotfix), then **Continue**:

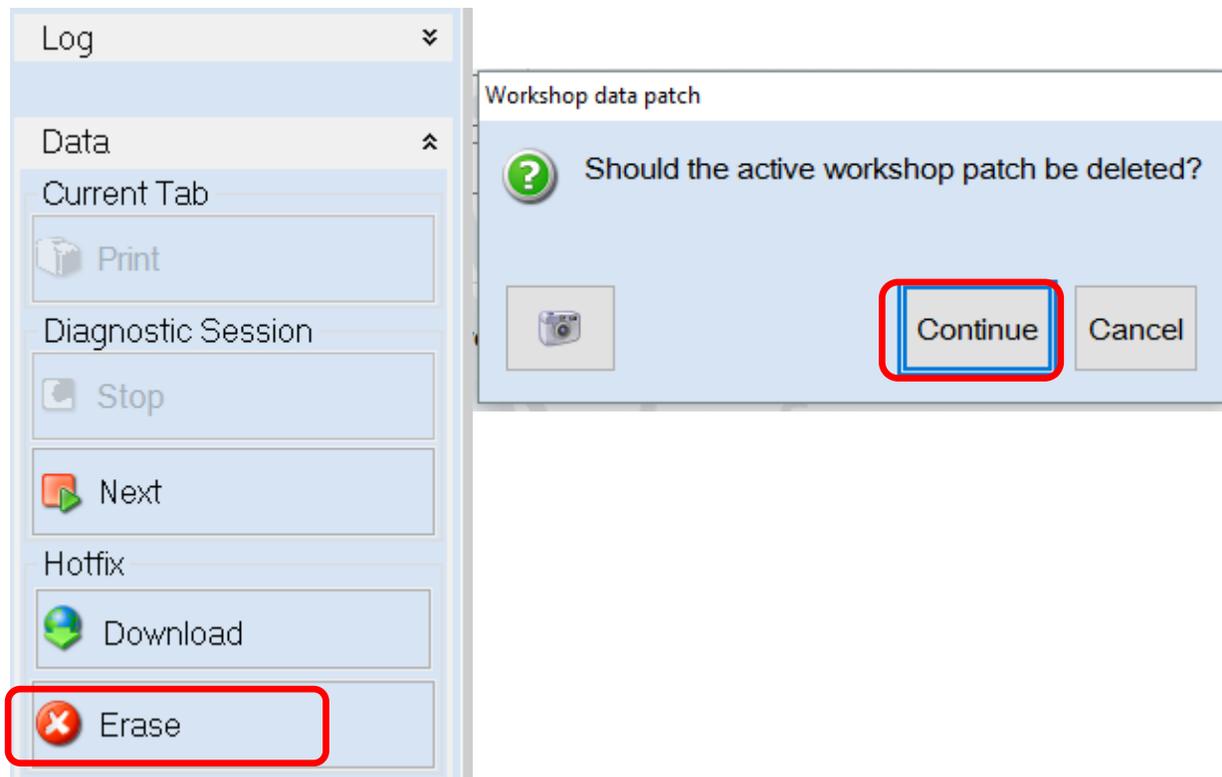

2. Click **OK** and close ODIS Service:

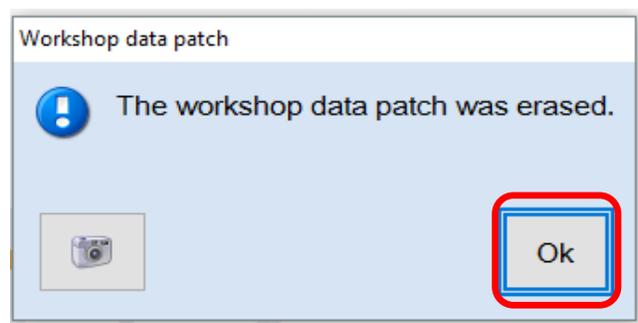

(continued)



Service Information

For questions or concerns, please reach out to David Provonche, 248-754-6091.

extern.dave.provonche@audi.com

Audi GFF / ODIS Validation / Service42 Research

VWGoA, Inc.

Product Quality & Technical Service