

Condition

ATTENTION:

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas Atlas Cross Sport	2024 - 2025	2.0T (DRKB)	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2075250/2	3/27/2025	01-24-01TT	Include Model Year 2025
2075250/1	09/12/2024	01-24-01TT	Original Publication

Technical Background

Damage to the front O2 sensor during factory installation can cause erroneous readings that may result in drivability issues and/or a MIL on. (See Figure 1 below for an example.)

One or more of the following fault code(s) may be stored in the ECM:

DTC	Description
P0087	Fuel Rail/System Pressure - Too Low
P0133	O2 Sensor Circ.,Bank1-Sensor1 Slow
P0171	Fuel Trim,Bank1 System too Lean
P2177	System too lean off idle, Bank 1

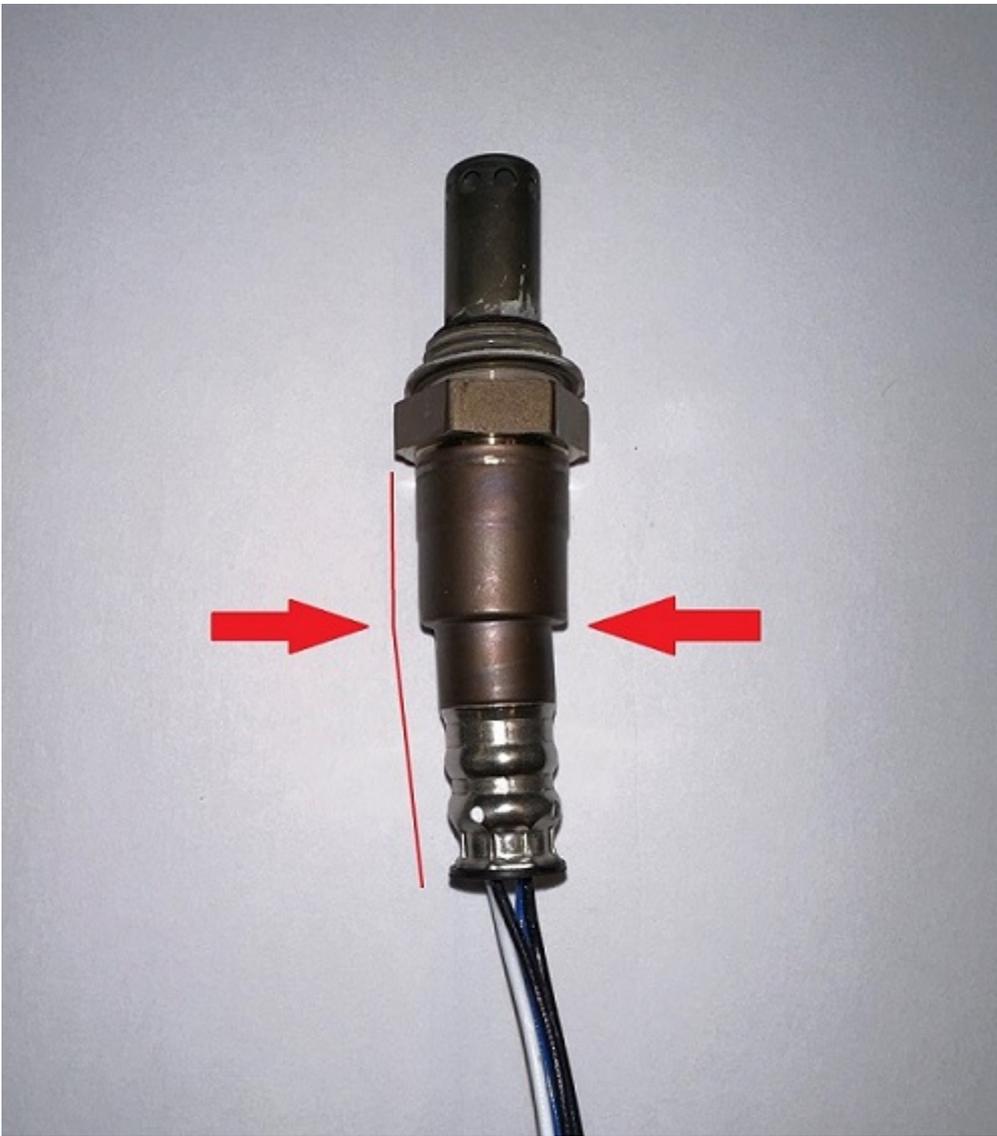


Figure 1.

Production Solution

Improved installation process of front O2 sensor during assembly.

Service

Visually inspect the front O2 sensor for signs of the upper housing being bent. If damage is found, replace the front O2 sensor.

Additional Information

© 2025 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.