



**TECHNICAL SERVICE BULLETIN**  
**Illuminated MIL With DTCs P0300 And P0316**

**25-2133**

02 April 2025

**Model:**

<b>Ford</b> 2023-2025 Escape	Engine: 1.5L EcoBoost Built on or before 20-Mar-2025
2025 Bronco Sport	Engine: 1.5L EcoBoost Built on or before 25-Mar-2025

**Markets:** North American markets only

**Issue:** Some of the vehicles listed in the Model statement above may exhibit an illuminated MIL with DTCs P0300 and P0316. This concern may occur after initial engine start up following an overnight cold soak.

**Action:** For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure to reprogram the PCM.

**Warranty Status:** Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Emissions Warranty/Service Part Warranty (SPW)/Service Part New Vehicle (SPNV)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/Emissions Warranty/SPW/SPNV/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**Labor Times**

Description	Operation No.	Time
2023-2025 Escape, 2025 Bronco Sport 1.5L EcoBoost: Perform Software Update For PCM. Includes Time To Clear Codes. (Do Not Use With Any Labor Operations Out Side Of This Article)	252133A	0.3 Hrs.

**Repair/Claim Coding**

Causal Part:	RECALEM
Condition Code:	04

**Service Procedure**

1. Connect a battery charger such as Rotunda GRX-3590 or DCA-8000 to the 12-volt battery.

**NOTE:** To prevent the battery saver mode from activating on the vehicle, make sure the negative cable of the charger is installed on a chassis or engine ground, and not the 12-volt battery negative terminal. Do not have the vehicle plugged into high voltage battery charger during programming. This can cause incorrect module programming. Make sure only the 12-volt battery charger is installed.

2. Download and run the "PCM-Powertrain Control Module (PCM) Software Update" application in the FDRS scan tool.

3. Clear DTCs from the PCM.

---

© 2025 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.