

Technical Service Bulletin (TSB) Front Collision Prevention Warning On

REFERENCE:	TSB: 08-114-25 GROUP: 08 - Electrical	Date:	April 11, 2025	REVISION:	—
VEHICLES AFFECTED:	2024 (KM) Jeep Wagoneer S This bulletin applies to vehicles built on or after August 08, 2024 (MDH 0808XX) and on or before October 14, 2024 (MDH 1014XX) equipped with Adaptive Cruise Control w/Stop & Go (Sales Code NHZ).			MARKET APPLICABILITY: <div><input checked="" type="checkbox"/> NA<input type="checkbox"/> MEA <input type="checkbox"/> SA<input type="checkbox"/> IAP <input type="checkbox"/> EE<input type="checkbox"/> CH</div>	
CUSTOMER SYMPTOM:	Customer may experience the following: <ul style="list-style-type: none">'Forward Collision Disabled/Service Automatic Emergency Braking' warning lights on in Instrument Panel Cluster (IPC).Both Adaptive Cruise Control (ACC) and Front Impact Braking are inoperative.				
CAUSE:	Parts supplied to the plant with the incorrect software level.				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-060, date of issue April 11, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves replacing the Front Long Range Radar.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-22-01-94	Module, Radar Long Range - Inspect and Replace (0 - Introduction)	6 - Electrical and Body Systems	1.8 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	04672966AH	Radar, Long Range, Front	—

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or equivalent	-	-

REPAIR PROCEDURE:

1. Replace the Front Long Range Radar. Refer to the detailed service procedures listed in DealerCONNECT>Service Library>Service Info under: 08 - Electrical / 8B - Driver Assistance / Assistance System Components / Radars / Removal and Installation.
2. Calibrate the Front Long Range Radar using either the on-road calibration routine or static/in bay calibration routine in WiTech. Refer to the detailed service procedures listed in DealerCONNECT>Service Library>Service Info under: 08 - Electrical / 8B - Driver Assistance / Programming and Calibration / Programming and Calibration.

NOTE: Proxi alignment is NOT required for Front Long Range Radar replacement.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.