



Service Bulletin

Bulletin No.: 24-NA-003
Date: March, 2025

TECHNICAL

Subject: Sunroof Wind / Air Deflector Inoperative

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2017	2024	-	-	All	All
Chevrolet	Traverse						
GMC	Acadia						


Involved Region or Country	North America, Middle East, Israel, Palestine, Chili, Columbia, Peru, China - SGM
Additional Options (RPOs)	Equipped with ROOF-SUN, GLASS, SLIDING, ELEC, TRANSPARENT GLASS FIXED (RPO C3U, LFY)
Condition	Some customers may comment on the wind / air deflector coming unsecured and or not allowing the sunroof to operate as intended.
Cause	The cause of the condition may be due to the clip securing the wind / air deflector has come unsecured and/or broken.
Correction	Replace the clips and secure the deflector as needed.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.


If you encounter a vehicle with the above concern, complete the following:

1. Open the sunroof window to the Fully Open position.

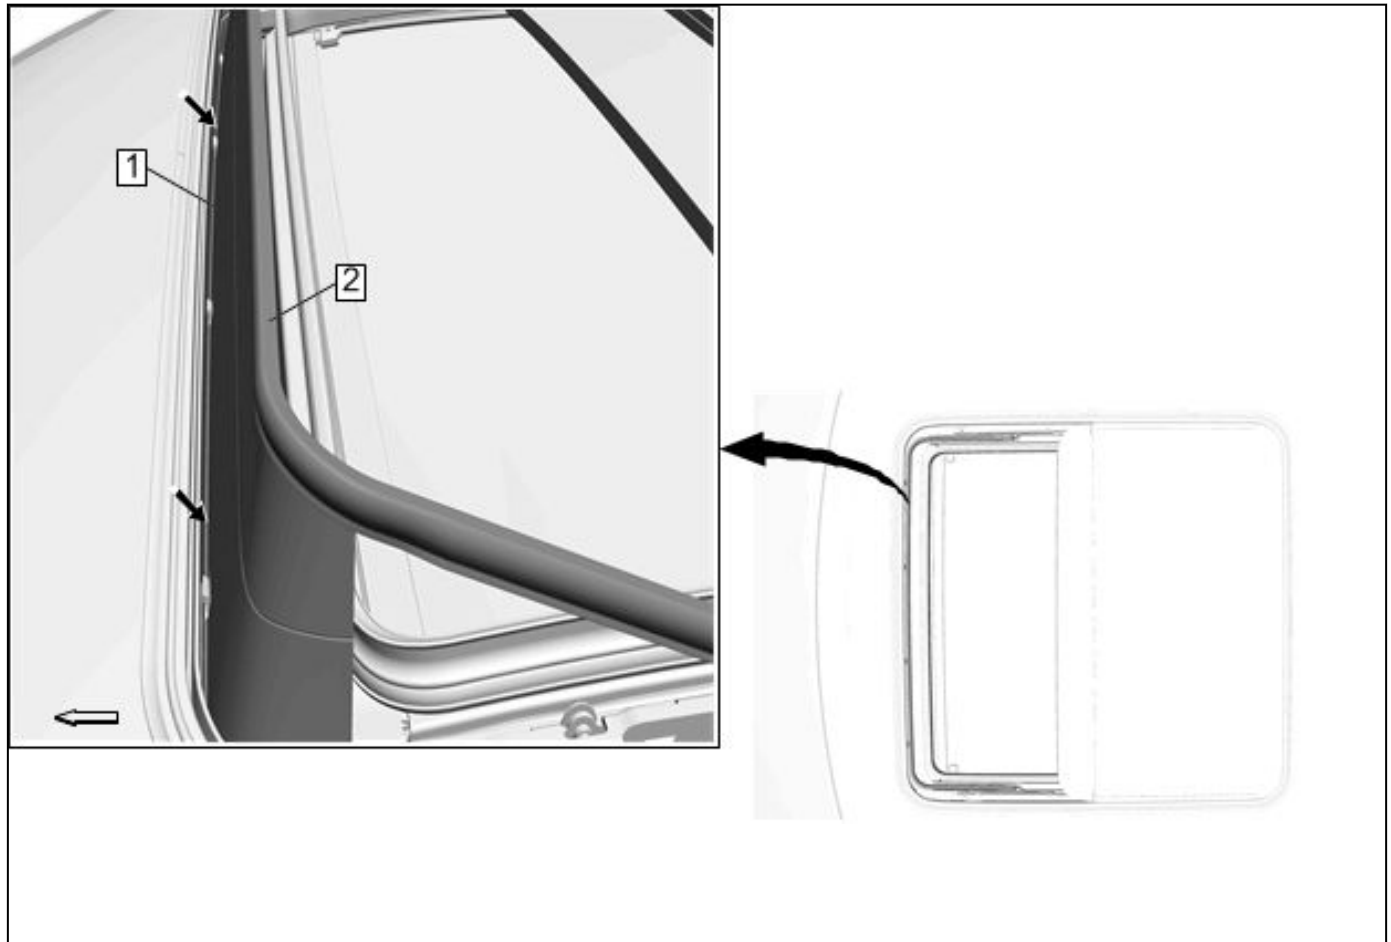

4242149

2. Using a suitable tool, push the sunroof air deflector (2) down and back to release it from the sunroof housing assembly clips (1).

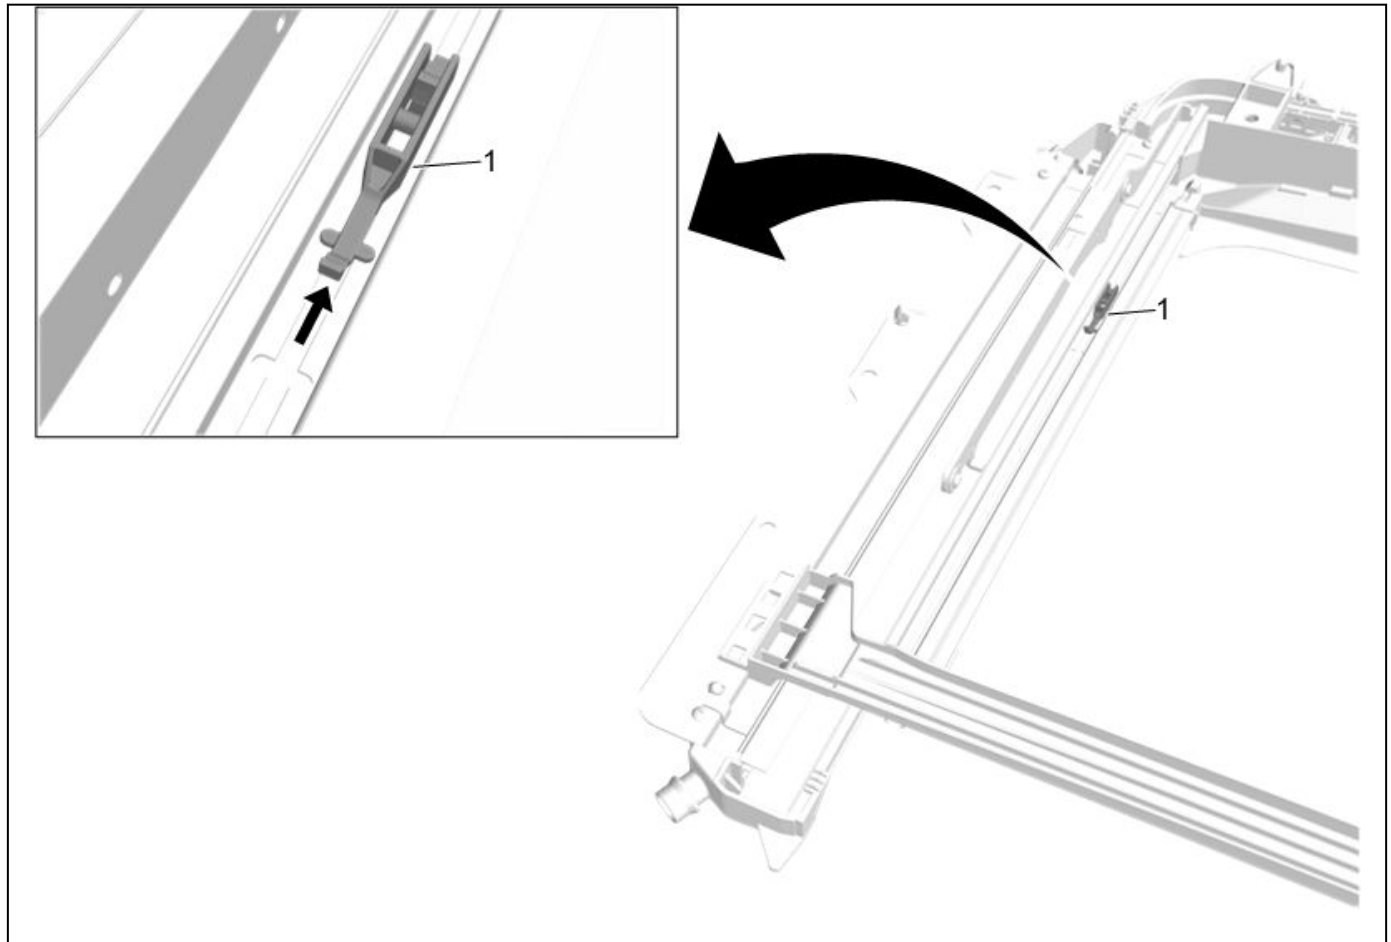

6489927

3. Pull the sunroof air deflector (2) upward and back to remove.

Note: If the sunroof air deflector clip is broken, confirm that all pieces are found and removed.

4. Place the new sunroof air deflector clips (1) into the sunroof housing rails, and gently slide them back until the wings are fully seated into the rail cutouts (2).

Note: Very little downward force is required to show if a micro-fracture is present.

5. Reinstall deflector and confirm operation.

Parts Information

Causal Part	Description	Part Number	Qty
X	GUIDE ASM-SUN RF W/ DFL	85043292	As needed (2 Clips Max per vehicle)

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*2086908	Sunroof Guide Clip Replacement	0.3 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	Released January 16, 2024 Revised March 19, 2025 – Updated Step 4.

