

<b>REFERENCE:</b>	<b>TSB:</b> 09-009-25 <b>GROUP:</b> 09 - Engine	<b>Date:</b>	April 23, 2025	<b>REVISION:</b>	—
<b>VEHICLES AFFECTED:</b>	<p><b>2024 - 2025 (B1) Jeep Renegade</b>  <b>2024 - 2025 (H1) Jeep Commander</b>  <b>2024 - 2025 (M1) Jeep Compass</b>                  This bulletin applies to B1 vehicles built on and after May 21, 2024 (MDH 0521XX) and on or before October 17, 2024 (MDH 1017XX) equipped one of the following:</p> <ul style="list-style-type: none"> <li>• 1.3L I4 Turbo Mair DI Eng w/ESS E100 (Sales Code EYJ).</li> <li>• 1.3L I4 Turbo MAir DI Engine (Sales Code EYH).</li> </ul> <p>This bulletin applies to H1 and M1 vehicles built on and after May 21, 2024 (MDH 0521XX) and on or before October 22, 2024 (MDH 1022XX) equipped with one of the following:</p> <ul style="list-style-type: none"> <li>• 1.3L I4 Turbo Mair DI Eng w/ESS E100 (Sales Code EYJ).</li> <li>• 1.3L I4 Turbo MAir DI Engine w/ESS (Sales Code EYF).</li> </ul>			<p><b>MARKET APPLICABILITY:</b></p> <p><input checked="" type="checkbox"/> NA                      <input type="checkbox"/> MEA  <input type="checkbox"/> EE                              <input type="checkbox"/> IAP  <input checked="" type="checkbox"/> SA                              <input type="checkbox"/> CH</p> <p><b>Not for US and Canada</b></p>	
<b>CUSTOMER SYMPTOM:</b>	<p><b>Customers may experience the following:</b></p> <ul style="list-style-type: none"> <li>• The customer notices the problem through a noise in the front right part in the engine area during parking maneuvers when changing gear from R to D, as well as when reversing from D to R.</li> </ul>				
<b>CAUSE:</b>	Excessive engine mount movement				

**This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-073, date of issue April 23, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.**

**REPAIR SUMMARY:**

This bulletin involves inspecting the right hand side engine mount and replacing it as needed.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
09-40-20-9E	Engine Mount - Inspect (1 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
09-40-20-9F	Engine Mount - Inspect and Replace (1 - Introduction)	1 - Engine Repair and Performance	0.7 Hrs.
Failure Code	ZY	Service Action	

## SPARE PARTS:

Qty	Part No.	Description	Notes
1	68670472AA - NA 7095417 - SA	Right Insulator	–

**NOTE: Only for the Brazil and Argentina markets. New parts requests will only be approved with the inclusion of the order on the "Recall Order with VIN" screen in CSPS, in accordance with the Standard Procedure "00 - Request for campaign parts," published in the Service Library.**

## DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

## REPAIR PROCEDURE:

1. Start the vehicle with the air conditioning turned off, wait until the engine runs the fan, and then move the vehicle from Drive to Park and check if you hear any noise on the right side of the engine.
2. Is any noise heard on the right side of the engine?
  - YES>>> Proceed to [Step 3](#).
  - NO>>> This bulletin has been completed. Use Inspection LOP (09-40-20-9E) to close the active RSU.
3. Replace the right hand side engine mount. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 1008B10 - Coxim elastico do suporte dianteiro (lado distribuicao) do grupo motopropulsor - remocao/recolocacao. incluso procedimentos necessarios.

## POLICY:

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*