



SSM 53688 2024-2025 Aviator - Air Suspension Fault Message In The IPC - DTCs B1041 And U2100 In The SUMA After Diagnosis And/Or Repair

Some 2024-2025 Aviator vehicles equipped with air suspension may exhibit a drive malfunction and/or suspension fault message in the instrument panel cluster (IPC) with diagnostic trouble codes (DTCs) B1041 and U2100 stored in the suspension control module A (SUMA). This may be due to the SUMA entering diagnostic service mode following suspension system diagnosis or repair. Clear DTCs using FDRS > "SUMA > Transport and Factory Mode Deactivation" function. For other DTCs refer to Workshop Manual (WSM) > Section 204-05 Vehicle Dynamic Suspension for normal diagnostics.