

# SS 286-FCCC Low Coolant Warning Buzzer

## **Applicable Vehicles**

S2C, B2

## **Symptoms**

A low coolant warning buzzer will sound without illuminating the corresponding MIL on the cluster.

## **Issue**

An incorrect parameter was installed causing conflicting messages to the ICU.

## **Solution**

Using CHEC update parameter 26 01064 001 to 26 01064 000 and flashing the BHM to the latest software. If you don't have CHEC please call FCCC Call Center for assistance at 800 206 3519.

Labels :

Busses

RV and Motorhomes

Add tags



0 Kudos

Comment

