

## Technical Service Bulletin

|                        |                                                                                      |
|------------------------|--------------------------------------------------------------------------------------|
| <b>Topic</b>           | 93 Q4 drive system fault P060600/P0A1B00 Power electronics control unit 00CE (front) |
| <b>Market area</b>     | United States 444 Volkswagen of America, Inc. (6444)                                 |
| <b>Brand</b>           | Audi                                                                                 |
| <b>Transaction No.</b> | 2073435/2                                                                            |
| <b>Level</b>           | EH                                                                                   |
| <b>Status</b>          | Released for publishing                                                              |
| <b>Release date</b>    | Apr 10, 2025                                                                         |

### Diagnostic trouble codes

| Diagnostic address      | Diagnostic trouble code                 | Fault symptom | Storage state |
|-------------------------|-----------------------------------------|---------------|---------------|
| 00CE - Electric drive 2 | P060600: Control Module Processor       |               | Intermittent  |
| 00CE - Electric drive 2 | P060600: Control Module Processor       |               | static        |
| 00CE - Electric drive 2 | P0A1B00: Drive Motor "A" Control Module |               | Intermittent  |
| 00CE - Electric drive 2 | P0A1B00: Drive Motor "A" Control Module |               | static        |

### New customer code

| Object of complaint                              | Complaint type               | Position |
|--------------------------------------------------|------------------------------|----------|
| engine -> engine operation -> electro-drive mode | functionality -> no function |          |

### New workshop code

| Object of complaint                                                                                                          | Complaint type                               | Position |
|------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|----------|
| engine -> electric motor drive -> power and control electronics for electro-drive -> control module for electric drive motor | control modules, services -> software faulty | front    |

## Vehicle data

### Q4 e-tron

#### Sales types

| Type | MY   | Brand | Designation | Engine code | Gearbox code | Final drive code |
|------|------|-------|-------------|-------------|--------------|------------------|
| F4B* | 2022 | A     |             | *           | *            | *                |
| F4B* | 2023 | A     |             | *           | *            | *                |

#### Control units

| Diagnostic address      | Software part number | Software version | Hardware part number | Hardware version |
|-------------------------|----------------------|------------------|----------------------|------------------|
| 00CE - Electric drive 2 | *1ED*.907.121*       | 8351             | *1ED*.907.121*       | H11              |

## Documents

| Document name              |
|----------------------------|
| <a href="#">master.xml</a> |

## Condition

| REVISION HISTORY |            |                                                                                                                |
|------------------|------------|----------------------------------------------------------------------------------------------------------------|
| Revision         | Date       | Purpose                                                                                                        |
| 2                | -          | Revised <i>Service</i> (Added relevant campaign and TSB)<br>Revised <i>Warranty</i> (Updated Labor operation.) |
| 1                | 04/03/2024 | Initial publication                                                                                            |

### Customer states:

- The yellow high-voltage warning lamp lights up.
- The electric drive warning lamp lights up.
- The message “Electric drive: fault. Please contact “Service” appears (Figure 1).



**Figure 1.** Warning message.

### Workshop findings:

Intermittent/static event memory entries logged in diagnostic address 00CE (Electric drive 2):

- **P060600:** ECM/PCM Processor.
- **P0A1B00:** Drive Motor "A" Control Module.

If the complaint occurs, the vehicle can be operated again after the ignition has been switched off and on again.

## Technical Background

Software issue in diagnostic address 00CE.

## Production Solution

Optimized software implemented in electric drive control unit 2 (-JX4-, diagnostic address: 00CE).

## Service

This TSB replaces Pending Service Solution (PSS) TSB 2068370/1: *PSS 93 Electrical Malfunction Message Displayed on Start up, DTCs P060600 and P0A1B00 Stored in Electric drive 2.*

Check for service campaign availability depending on current control unit network and perform any open service campaigns if necessary.

- **91EV (update ME 3.2)**
- **91FN (update ME 3.2.1)**
- **TSB 2074069 (update ME 3.5)**

## Warranty

|                          |                                                                                                                                                     |           |                                        |
|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|-----------|----------------------------------------|
| <b>Claim Type:</b>       | <ul style="list-style-type: none"><li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li></ul> |           |                                        |
| <b>Service Number:</b>   | 9370                                                                                                                                                |           |                                        |
| <b>Damage Code:</b>      | 0040                                                                                                                                                |           |                                        |
| <b>Labor Operations:</b> | Software update                                                                                                                                     | 0151 0010 | See SRT with associated operations     |
|                          | Software update                                                                                                                                     | 0151 0060 | Time stated on the diagnostic protocol |
| <b>Claim Comment:</b>    | As per TSB 2073435/2                                                                                                                                |           |                                        |

Please note any open campaigns and perform them accordingly.

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All parts and service references provided in this TSB (**2073435**) are subject to change and/or removal.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.