



Subject: A/C COMPRESSOR OPERATES AND MAKES AN ERRATIC BUZZING NOISE AFTER SWITCHING THE IGNITION OFF	Service Alert No.: SA-019/25
	Last Issued : 04/11/2025

BULLETIN NOTES

APPLICABLE MODEL(S).VINS

2024-2025 CX-90 PHEV (e-SKYACTIV) with VINS lower than JM3KK*****219454 (produced before November 30, 2024)

2025 CX-70 PHEV (e-SKYACTIV) with VINS lower than JM3KJ*****118740 (produced before October 16, 2024)

DESCRIPTION

Some vehicles may exhibit the A/C compressor operating and making a buzzing noise after switching the ignition off. This may be caused by improper control logic of the PCM. To eliminate this for customer satisfaction, the control software of the PCM has been modified.

1. Check for open recalls.

Are any Recalls open?

- YES:** Perform any open Recall(s), then continue to the next step.
- NO:** Continue to the next step.

2. Check the current software level of the PCM to see if is the same (or later suffix) as shown in Calibration Files Information.

Is the current calibration file name the same (or a later suffix)?

- YES:** Diagnose the issue using MGSS.
- NO:** Verify the Recalls were performed correctly.

CALIBRATION

CX-70

ECU	File Name (New)
PCM	MS18-186K2-L or later
	MS19-186K2-L or later
ECM	PW64-188K2-K or later
TCM	PW64-21PS1-H or later

CX-90

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

ECU	File Name (New)
PCM	MS65-186K2-B or later
	MS66-186K2-B or later
ECM	PXRC-188K2-U or later
TCM	PXPN-21PS1-K or later

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.