

## EPICD (DC/DC) FAULT U3008-13 CONNECTOR C31VR/WR

### Range Rover

- 22-25MY Range Rover
- 23-25MY RR Sport

JLR

### Concern:

- Customer may report *"Stop Safely Electrical Fault"* warning is present in the Instrument cluster display.
- EPICD (DC/DC) reports DTC U3008-13 Control Module Ground "A" - Circuit open

### Technical Description:

- DTC may be caused by damage to #9 circuit running through connector C31VR/WR.
- Loose or damaged Pin/Terminals for this ground circuit have been found requiring repair to restore circuit function.

### Action:

- Reference **SSM76303** and complete steps to repair the connector as necessary.
- Raise EPQR and provide photo of any fault identified with the C31VR/WR connector for review.

