



Bulletin No.: PIP6058A
Published date: 04/30/2025

Preliminary Information

PIP6058A Diagnostic Tip: DTC P0299 Or P0234 Set As Current Or In History

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Buick	Envista	2024 - 2025	All	All 1.2 LBP/LIH	All
Chevrolet	Trax	2024 - 2025	All	All 1.2 LBP/LIH	All

Involved Region or Country	North America
Condition	DTC p0299 P0234 set as current or in history.
Cause	Binding Turbocharger Wastegate.

Correction:

If you encounter one of the above mentioned vehicles with DTC p0299/p0234 set as current or in history this may be due to the Turbocharger wastegate binding.

Complete the published SI diagnostics for the for the related DTC. If the diagnostics are inconclusive, it will be necessary to remove the Turbocharger and validate the wastegate by hand to see if additional force is needed to operate the Wastegate Valve. Reference video attachment below.

If additional force is required to operate the Turbocharger Wastegate it will be necessary to replace the Turbocharger using the latest listing in EPC. Prior to installation of the replacement Turbocharger please perform the same Wastegate operation test by hand to verify the Wastegate is operating normally and not sticking.

SI video [6877908](#)

Customer Information

This Preliminary information communicates to the dealers the possibility of dtc p0299 p0234 setting due to wastegate binding

Version History

Version	2
Modified	04/15/2025 - Created on. 04/30/2025 Updated Model Year.

