



# Service Bulletin

Bulletin No.: 23-NA-066

Date: April, 2025

## TECHNICAL

**Subject: Information on Malfunction Indicator Lamp (MIL) Illuminated - Multiple DTCs Set**

**This bulletin replaces 24-NA-058, 23-NA-213, 23-NA-152 and PIP5966. Please discard 24-NA-058, 23-NA-213, 23-NA-152 and PIP5966.**

| Brand:    | Model:                  | Model Year: |      | Vehicle Build Date Breakpoint: |    | Engine:    | Transmission: |
|-----------|-------------------------|-------------|------|--------------------------------|----|------------|---------------|
|           |                         | from        | to   | from                           | to |            |               |
| Chevrolet | Silverado 2500HD/3500HD | 2024        | 2024 |                                |    | 6.6L (L5P) |               |
| GMC       | Sierra 2500HD/3500HD    |             |      |                                |    |            |               |

|                                   |                                                                      |
|-----------------------------------|----------------------------------------------------------------------|
| <b>Involved Region or Country</b> | North America, Middle East, Israel, Palestine, Australia/New Zealand |
|-----------------------------------|----------------------------------------------------------------------|

|                       |                                                                                                                                                                                                                                                                                                                                                |
|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Release Date:</b>  | <b>What The Release Addresses:</b>                                                                                                                                                                                                                                                                                                             |
| <b>July 1, 2023</b>   | <ul style="list-style-type: none"><li>• P0402</li><li>• P062D</li><li>• P144E</li><li>• P242B</li><li>• P2459</li><li>• P2635</li></ul>                                                                                                                                                                                                        |
| <b>August 1, 2023</b> | <ul style="list-style-type: none"><li>• P0606</li><li>• P060C</li><li>• P2463</li><li>• P2459</li></ul> <p>Some technicians may also find for a vehicle that stalled with P060C, additional codes:</p> <ul style="list-style-type: none"><li>• P0090</li><li>• P0092</li><li>• P00C9</li><li>• P12A6</li><li>• P2294</li><li>• P2296</li></ul> |

|                         |                                                                                                                                                                                                                                                                                                 |
|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>December 1, 2023</b> | <p>Rough idle.<br/>Surge or buck with light throttle and higher loads.</p> <ul style="list-style-type: none"> <li>• P0402</li> <li>• P22FB</li> </ul> <p>Some technicians may also find that the vehicle stalls when attempting to command the EGR position.</p>                                |
| <b>April 1 2024</b>     | <ul style="list-style-type: none"> <li>• P062F</li> <li>• P040B</li> <li>• P041B</li> <li>• P0422</li> <li>• P060C</li> <li>• P062B</li> <li>• P1428</li> <li>• P142A</li> <li>• P20EE</li> <li>• P20FE</li> <li>• P22F9</li> <li>• P244A</li> <li>• P244B</li> </ul>                           |
| <b>October 01, 2024</b> | <p>Fuel Economy Complaints<br/>Engine Running Poorly with no DTCs:</p> <ul style="list-style-type: none"> <li>• P245B</li> <li>• P2463</li> <li>• P2959</li> </ul>                                                                                                                              |
| <b>January 1, 2025</b>  | <p>Engine Running Poorly with no DTCs:</p> <ul style="list-style-type: none"> <li>• P1089</li> </ul>                                                                                                                                                                                            |
| <b>Cause</b>            | This condition may be caused by a software anomaly.                                                                                                                                                                                                                                             |
| <b>Correction</b>       | <p>Please verify that all campaigns have been performed:</p> <ul style="list-style-type: none"> <li>• If all the campaigns are complete, reprogram the Engine Control Module (ECM) and Transmission Control Module (TCM).</li> <li>• If there are no updates available, refer to SI.</li> </ul> |

**Important:** Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

### Parts Information

No parts are required for this repair.

| Version  | 10                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|----------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Modified | <p>Released March 11, 2023</p> <p>Revised June 09, 2023 - Removed Software Anomaly information, Added Additional DTCs to bulletin, Added New Service Procedure section and Added New Labor to Warranty Information section.</p> <p>Revised July 27, 2023 - Updated the third Dash Line under the Service Procedure to Remove P2459.</p> <p>Revised December 15, 2023 - Added SOP to July 1 to Vehicle Build Date Breakpoint.</p> <p>Revised April 16, 2024 - Removed ECM Programing Information and added to Refer to N242438501 in Correction section.</p> <p>Revised May 17, 2024 - Combined Three Bulletins noted, into this One.</p> <p>Revised May 24, 2024 - Changed DTC P0442 to P0422.</p> <p>Revised October 07, 2024 - Added October 01, 2024 section.</p> <p>Revised December 18, 2024 - Added Jan. 1, 2025 to Calibration Year section.</p> <p>Revised April 08, 2025 - Update Correction section to add the TCM Update.</p> |

