

<b>REFERENCE:</b>	<b>TSB:</b> 08-139-25 <b>GROUP:</b> 08 - Electrical	<b>Date:</b>	April 30, 2025	<b>REVISION:</b>	—
<b>VEHICLES AFFECTED:</b>	<b>2025 (DT) RAM 1500 Pickup</b> This bulletin applies to vehicles built on or after January 28, 2025 (MDH 0128XX) and on and before April 04, 2025 (MDH 0404XX) equipped with the Smartphone As A Key Capable Module (Sales Code GX6).			<b>MARKET APPLICABILITY:</b>	
				<input checked="" type="checkbox"/> NA	<input type="checkbox"/> MEA
				<input checked="" type="checkbox"/> SA	<input type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
<b>CUSTOMER SYMPTOM:</b>	<b>Technicians may comment on the following:</b> <ul style="list-style-type: none"> <li>Technician finds Diagnostic Trouble Code (DTC) "B1898-00 - Digital Key Control Module Sensors Not Learned" has set erroneously with no Malfunction Indicator Lamp (MIL) illumination or actual customer facing symptoms.</li> </ul>				
<b>CAUSE:</b>	<b>Software programming</b>				

**REPAIR SUMMARY:**

This bulletin involves performing the DKCM Transceiver Position calibration.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
18-19-2V-90	Module, Digital Key Control (DKCM) - Perform Calibration (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	ZZ	Service Action	

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition above, perform the repair procedure.

**SPECIAL TOOLS/EQUIPMENT:**

Description	Ref. No.	Notes
wiTECH or Equivalent	—	—

## REPAIR PROCEDURE:

1. Using the scan tool, navigate to the Digital Key Control Module (DKCM) "Misc Functions" menu.
2. Select and run " Transceiver Position calibration".
3. Clear DTCs.

## POLICY:

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*