



Coach Control System Time Loss

Number: FT-ESB-0035

Issued Date: 04/04/2025

Issued by: _____ Approved by: _____

Priority: Urgent _____ High _____ Low X

1.0 Description of Affected Products: Coaches with a Silverleaf LR130

1.1 Unit Numbers: 9228-9271

2.0 Issue: Coach control system can potentially lose up to 2 hours of time overnight.

3.0 Solution: Update Silverleaf LR130 to latest firmware version.

4.0 Action: The firmware update can be downloaded via the link in the instructions below or emailed to a customer or tech then uploaded to the LR130 via a web browser. If that option is not available then the LR130 can be shipped back to Foretravel for updating.

5.0 References: N/A

6.0 Instructions:

6.1 The firmware file can be obtained from Foretravel tech support or downloaded from this link. <https://drive.google.com/file/d/1-slte4yYa2eveukoqzNH4ZMh1cnQx18/view?usp=sharing>

[slte4yYa2eveukoqzNH4ZMh1cnQx18/view?usp=sharing](https://drive.google.com/file/d/1-slte4yYa2eveukoqzNH4ZMh1cnQx18/view?usp=sharing)

6.2 Download the zip file but do not extract it. The LR130 will extract it automatically.



6.3 The LR130 IP address can be obtained from the Status tab on the WiFi Ranger control panel.

The screenshot shows the WiFi Ranger control panel interface. The 'Status' tab is selected and highlighted with a green circle. Below the tabs, there are three tables:

Connection	IP Address	Global IP Address	Default Gateway	Speed
Internal WiFi WAN 5GHz	172.17.197.8	173.219.19.174	172.17.196.1	16.98 Mbps



Interface	IP Address	Netmask	MAC Address
Internal WiFi WAN 5GHz	172.17.197.8	255.255.254.0	2C:C8:1B:C4:07:89
Public Network	10.54.45.1	255.255.255.0	F6:65:13:C4:C4:D1
Private Network	10.154.45.1	255.255.255.0	02:C8:1B:C4:07:88
Private Network Alias 3	10.100.254.1	255.255.255.0	02:C8:1B:C4:07:88
WFRControl Pairing Network	172.16.253.245	255.255.255.248	02:C8:1B:C4:07:88
Starlink Management	192.168.100.254	255.255.255.0	2C:C8:1B:C4:07:83

Device	IP Address	Interface	MAC Address	Conduit (Port)	Static	Remove
N/A	10.154.45.100	Private	AE:65:9F:15:D3:14			
LR130-0281D6ED54C	10.154.45.238	Private	02:81:D6:ED:54:AC			
E39	10.154.45.94	Private	C8:58:C0:FF:28:00			
N/A	10.100.254.2	Private	00:1F:B8:3C:0C:53			
Halo	10.154.45.73	Private	00:17:1A:A4:74:A4			
Nickname	IP Address		MAC Address			

6.4 Enter the IP address of the LR130 into a Chrome or Edge browser window with “/admin” at the end. Ex: 10.145.54.238/admin





6.5 The browser will display some form of a “connection not secure” message. Select Advanced then Proceed to... at the bottom of the page.

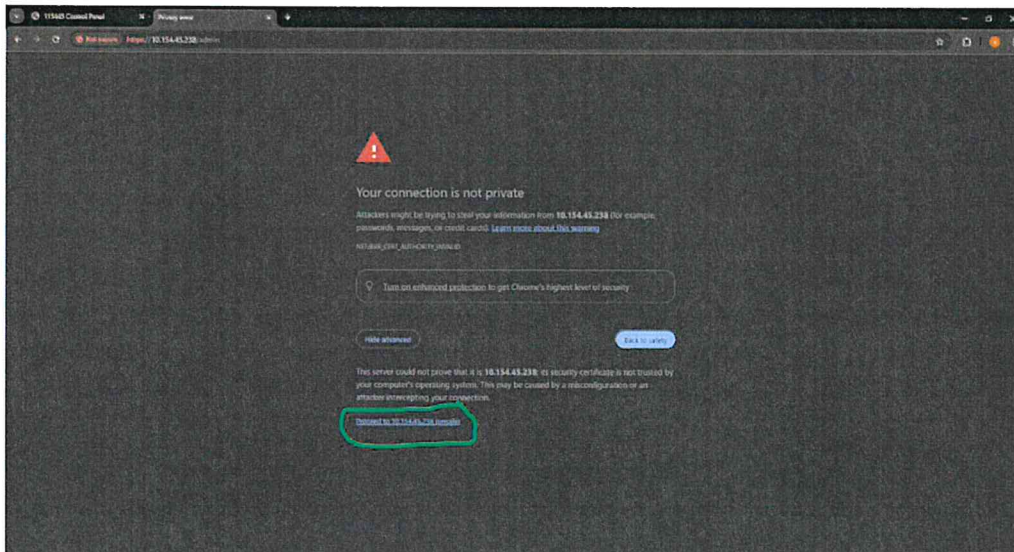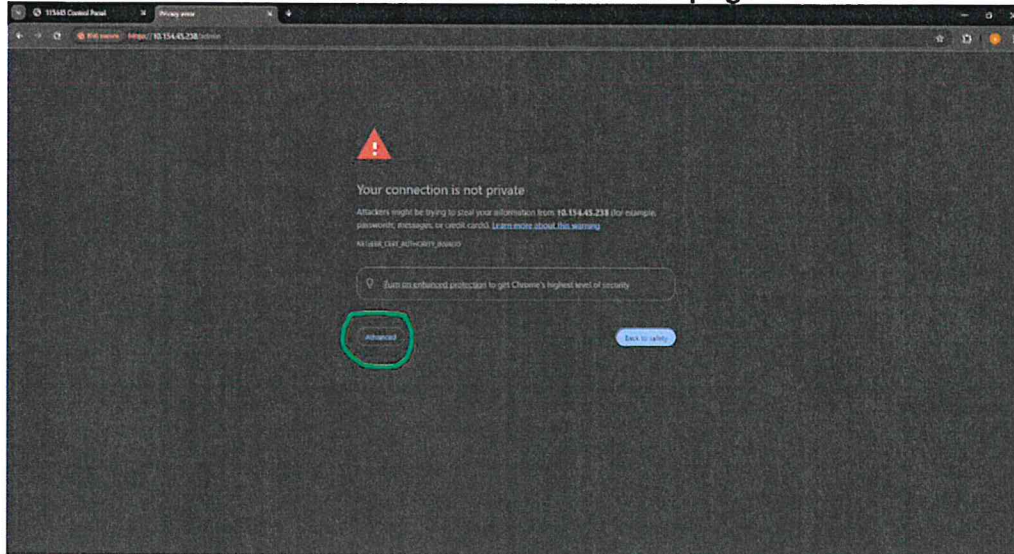




6.6 Select Menu on the top left of the page then Update Software.

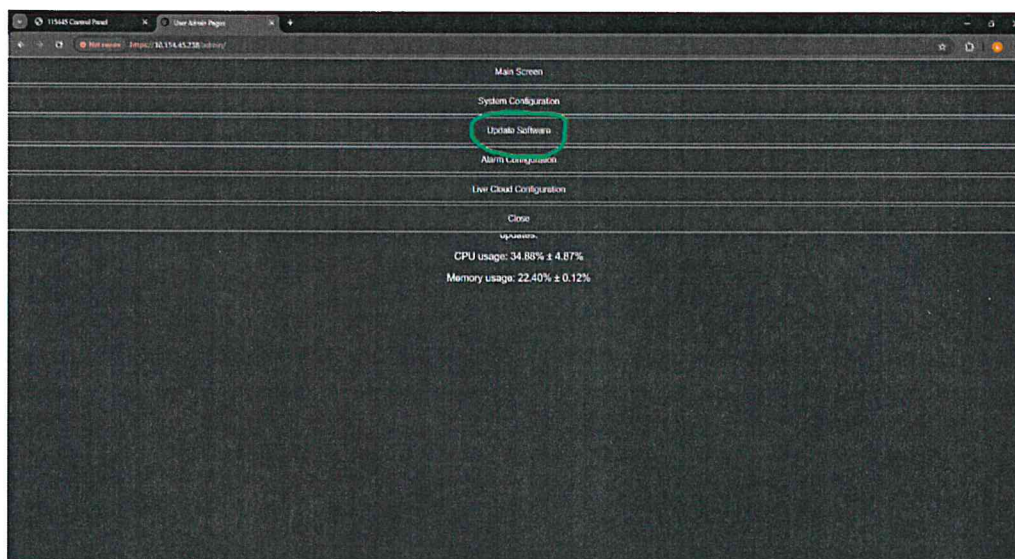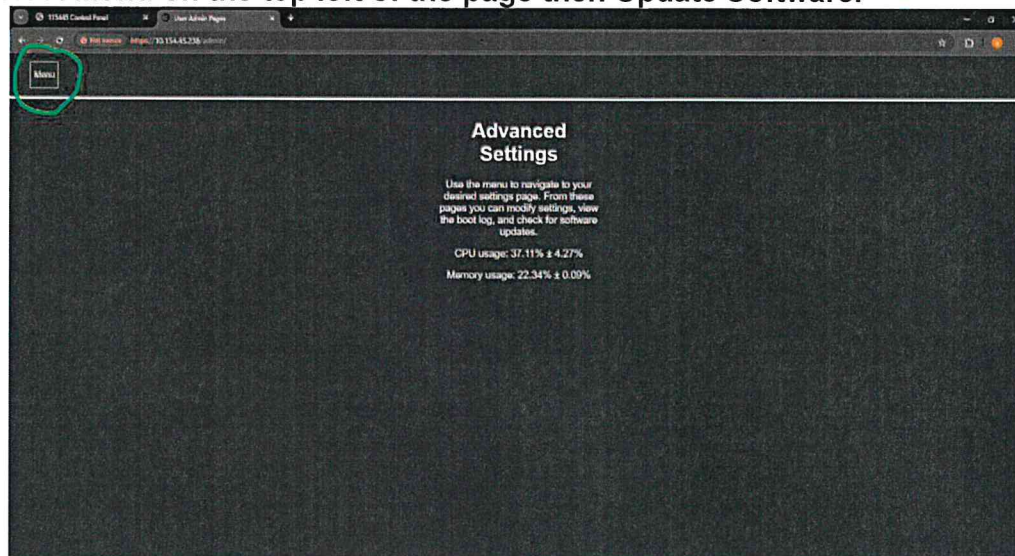




6.7 Select Choose File, browse to where the zip file is located on your device, and select it.

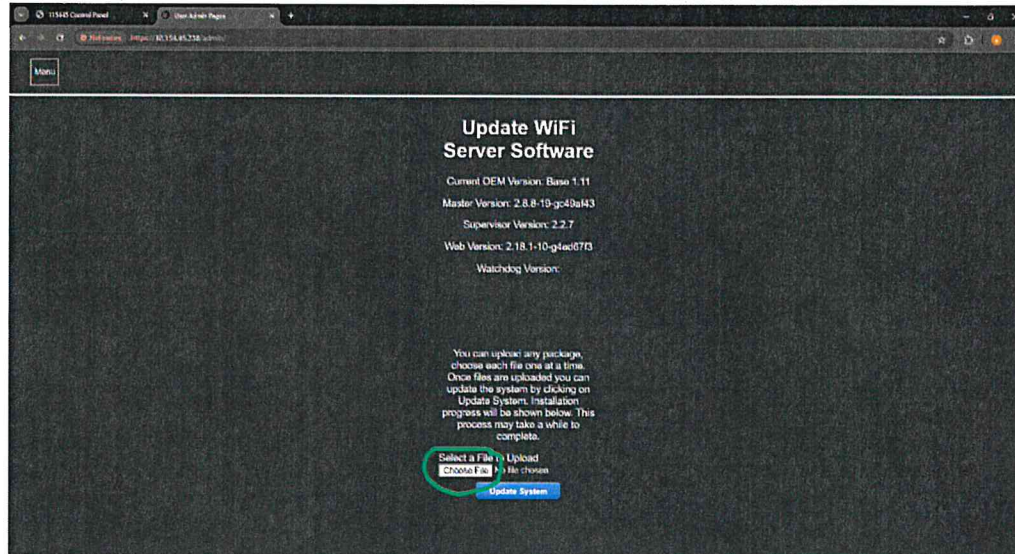


6.8 Once the upload is complete a confirmation pop up will display. Select OK.

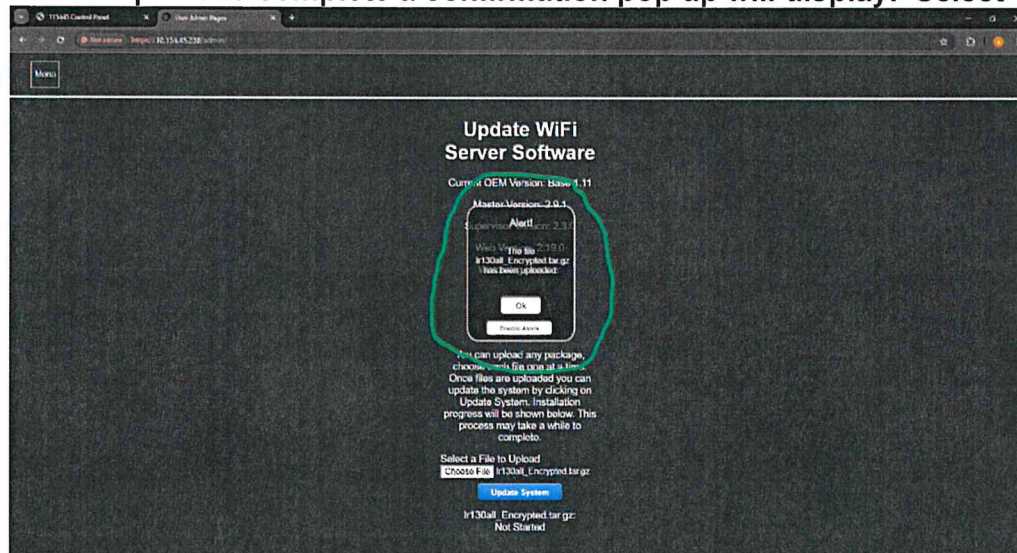




6.9 Select Update System at the bottom of the page. The LR130 update process will go through several stages which will be displayed at the bottom of the page.

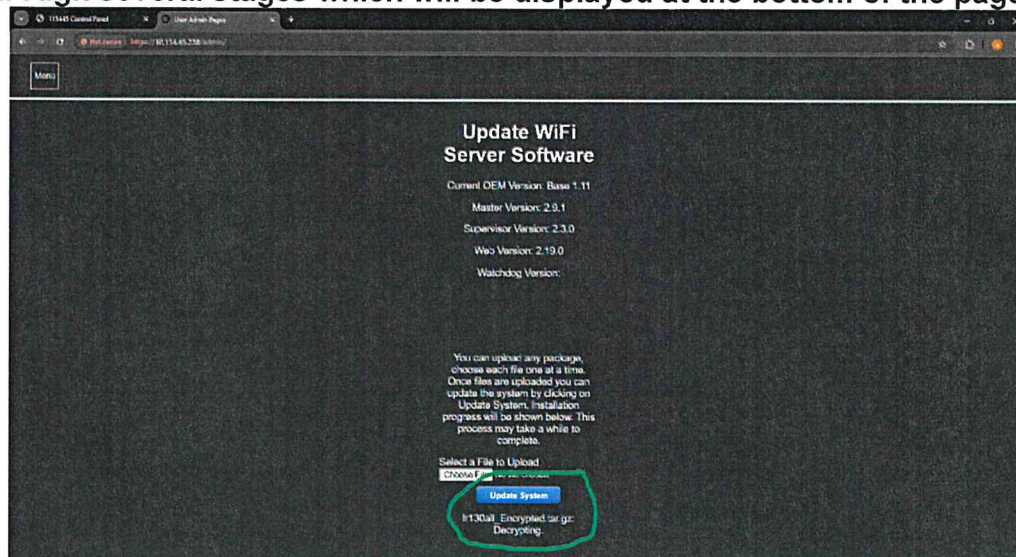

6.10 Once the update is complete a confirmation pop up will display stating that the LR130 is going to reboot.

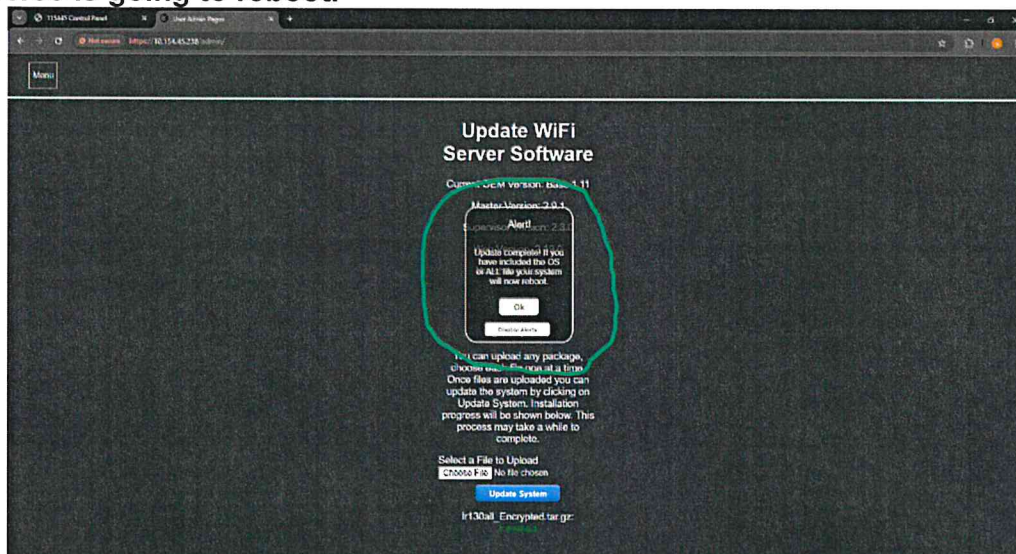

6.11 Select OK and exit the browser window. Wait at least 3 minutes before trying to access the coach via the System Control app.



FORETRAVEL
MOTORCOACH

7.0 Contact Information:

Foretravel Service Director
1221 NW Stallings Dr.
Nacogdoches, TX 75964

(800) 955-6226