


Message In The Instrument Cluster "Adaptive High Beams Assistant Not Available/Inoperative" or "DIGITAL LIGHT Reduced Range Of Functions"

Topic number	LI82.10-P-078470
Version	6
Function group	82.10 - Exterior lights
Date	5/14/25
Validity	Model series 206, model series 214, model series 236, model series 254, model series 294, model series 295 with steel suspension (without code 489, 490, 456)
Reason for change	Remedy Adjustment

Complaint

Message in instrument cluster "Adaptive high beams assistant not available/inoperative" or "DIGITAL LIGHT reduced range of functions" in relation to "FC151E29- The level sensor at front left has a malfunction. There is an invalid signal"

in the HLI control unit.

Attachments	
File	Description
60e01930-6851-4aa6-8111-7b1c602898e6.jpg	Message in instrument cluster
	

Cause

HLI control units processing of level sensor data.

Remedy

Update the software for the HLI control units - starting with the left controller. After the updates, perform SCN coding of the EZS.

Please ensure that the SW with the A item number A2239027738 (or newer) is used.

Parts replacements will not resolve complaint. Do not replace parts. If concern is not resolved by software, please open a TIPS case and send to the Body/Chassis/Entertainment inbox.

Concern does not impact drivability of the vehicle or the function of the headlights.

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms
Lighting > Exterior lights > Driving lights > High beams > Indicator lamp > lit

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
Nr.1	Update of HLI left		82B0390	
Nr.2	Update of HLI right		82P0390	