



Bulletin No.: PIC6606

Published date: 05/2/2025

Preliminary Information

PIC6606 Collision Alert Unavailable and/or Driver Assist Unavailable Message

Models

Brand: Cadillac **Model:** OPTIQ **Model Years:** 2025 **VIN:** from SOP to February 28, 2025 **Engine:** All **Transmissions:** All

Involved Region or Country	North America
Condition	Customer may comment of a Collision Alert or Driver Assist unavailable message. Technician may find DTC U0235 set as current.
Cause	BCM calibration causing the high voltage battery to not charge the 12V battery during transit mode.

Correction:

Engineering is investigating the calibrations for recovering the long range radar module (LRRM).

This PI will be updated or replaced with a TSB once a determination has been made.

In the meantime, dealers are to reprogram the BCM and replace the long range radar module after confirming there are no harness or connector issues involved.


Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming	Use Standard Published Labor Time
6620180	Forward (Long) Range Radar Sensor Replacement	Use Standard Published Labor Time

Version History

Version	1
Modified	05/02/2025 - Created on.

 GM Global Brands

© 2025 General Motors. All Rights Reserved.